

General Information

Date & Time: 03, Jun, 2025 14:00

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	35,984
Registration No.	NHE9958	Chassis No.	MHFAA1BY4P0020647
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



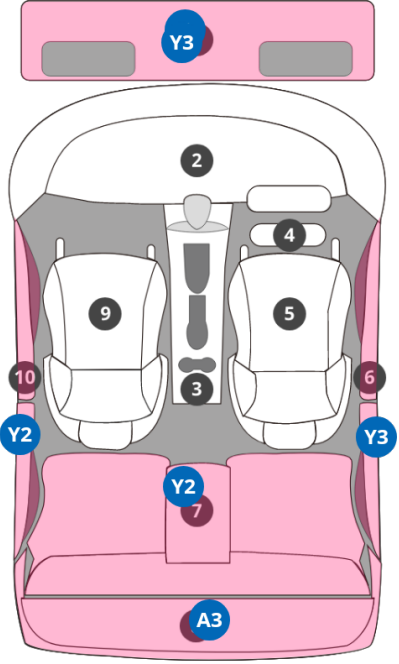
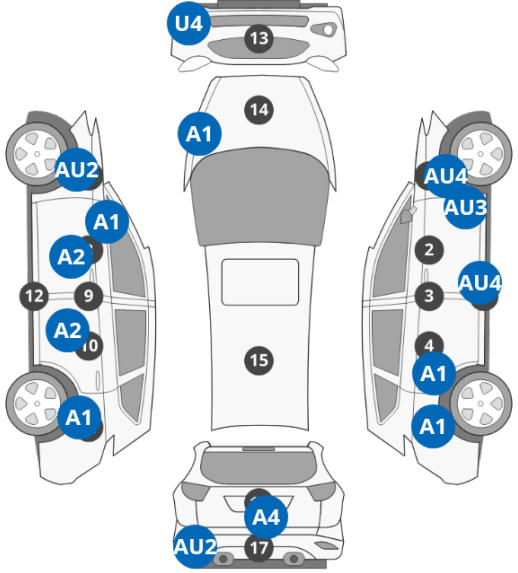
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	185.6	178	192	187
2	Boot Lid	191.6	198	192	185
3	Roof	223.0	248	248	186/210
4	Left Front Fender	181.0	179	177	187
5	Left Front Door	203.6	190	204	217
6	Center Panel Left				
7	Left Rear Door	201.0	197	189	217
8	Left Back Panel	204.6	214	170	230
9	Right Front Fender	184.3	201	189	163
10	Right Front Door	198.6	210	193	193
11	Center Panel Right				
12	Right Rear Door	199.6	201	194	204
13	Right Back Panel	191.3	209	178	187

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Rear Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Rear Trim - Grime - Small / Rear Seat - Grime - Small / Overall Interior - Smell - Yes / Ceiling - Grime - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Dent - Large / Bonnet, Headlight - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty booklet, no jack and tools, no spare tire, tow hook cover missing, busted plate light</p>