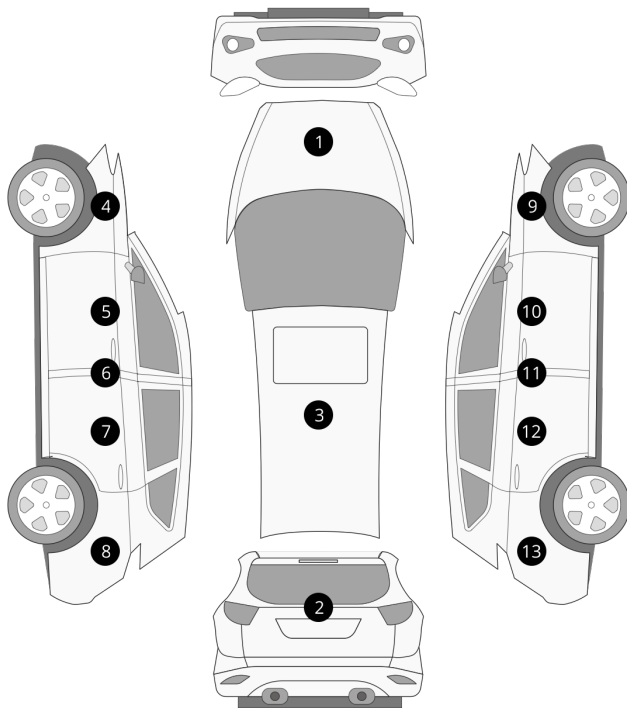


General Information

Date & Time: 16, Jul, 2025 13:16

Make	Toyota	Model	Hiace
YOM	2021	Odo Meter Reading	103,868
Registration No.	NGP4304	Chassis No.	JTFNAFAP7L8017229
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Black		

Body / Panel Condition



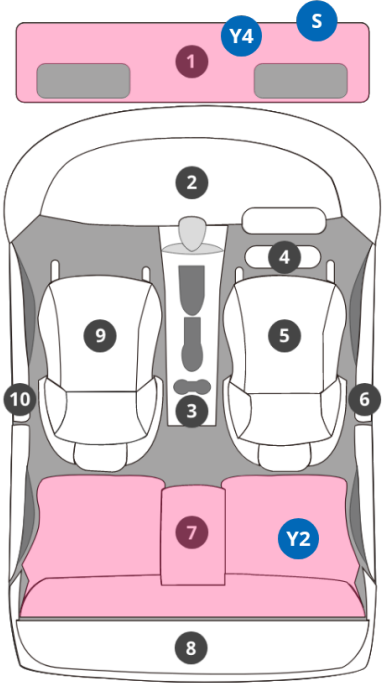
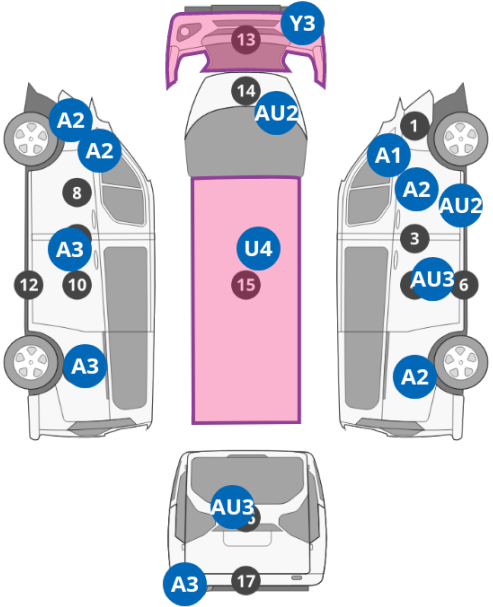
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	157.6	154	178	141
2	Boot Lid	107.3	110	104	108
3	Roof	182.7	178	312	126/115
4	Left Front Fender	128.6	116	121	149
5	Left Front Door	119.0	139	105	113
6	Center Panel Left	138.0	124	146	144
7	Left Rear Door	101.7	98	97	110
8	Left Back Panel	120.3	124	118	119
9	Right Front Fender	218.3	201	192	262
10	Right Front Door	121.6	106	117	142
11	Center Panel Right	148.3	153	167	125
12	Right Rear Door	112.3	125	106	106
13	Right Back Panel	117.3	120	115	117

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / Overall Interior - Smell - Yes / Ceiling - Grime - Large	Remarks (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Roof - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Roof - Dent - Large
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/No jack and tools/with warranty booklet/No reverse camera/ non moving vehicle