

## General Information

Date & Time: 02, Jun, 2025 13:29

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	10,391
<b>Registration No.</b>	NFR9419	<b>Chassis No.</b>	PA1B18F38R4258637
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



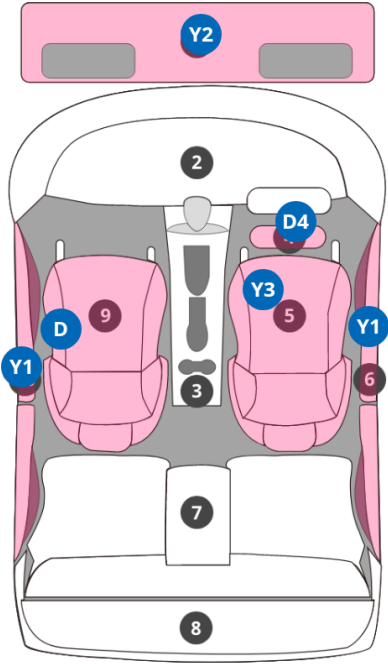
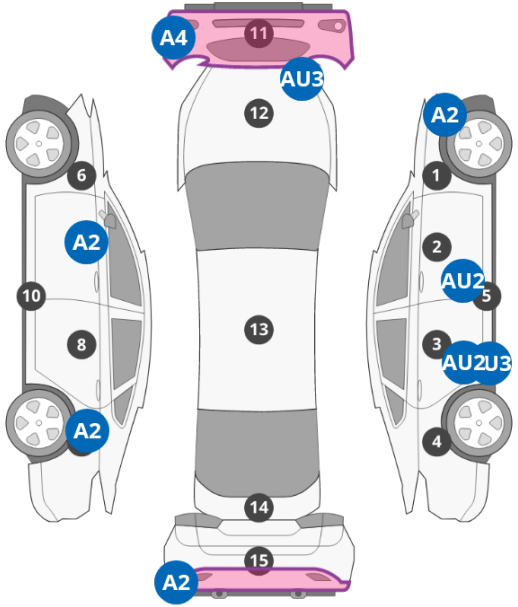
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.0	128	113	131
2	Boot Lid	114.6	112	113	119
3	Roof	117.5	122	110	114/124
4	Left Front Fender	223.6	210	204	257
5	Left Front Door	108.0	103	119	102
6	Center Panel Left				
7	Left Rear Door	216.6	192	293	165
8	Left Back Panel	173.0	165	198	156
9	Right Front Fender	109.6	104	102	123
10	Right Front Door	120.6	125	122	115
11	Center Panel Right				
12	Right Rear Door	118.0	106	116	132
13	Right Back Panel	117.3	121	112	119

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Large / (L) Front Trim - Grime - Minimal / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate but not attached, scratches on headlight</p>