

## General Information

Date & Time: 30, May, 2025 13:05

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	23,912
<b>Registration No.</b>	NIJ2171	<b>Chassis No.</b>	PA1B18F39P4203370
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



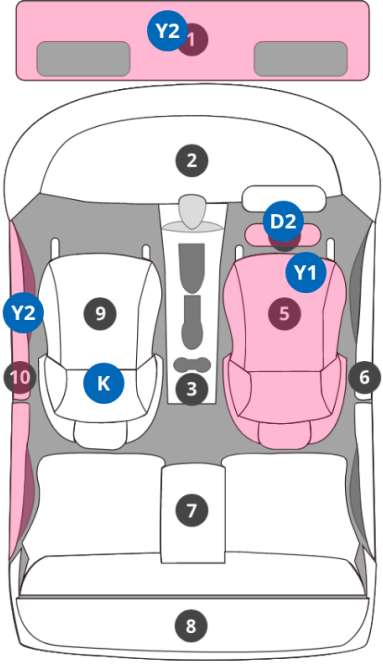
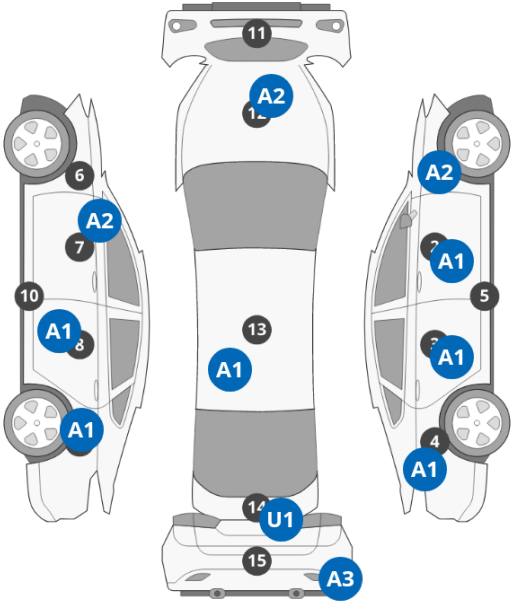
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	110	106	121
2	Boot Lid	103.6	98	103	110
3	Roof	100.7	100	97	108/98
4	Left Front Fender	93.3	90	96	94
5	Left Front Door	102.3	98	100	109
6	Center Panel Left				
7	Left Rear Door	105.1	122	101	92
8	Left Back Panel	107.0	109	103	109
9	Right Front Fender	116.0	115	108	125
10	Right Front Door	107.4	120	103	99
11	Center Panel Right				
12	Right Rear Door	89.8	87	89	94
13	Right Back Panel	201.6	300	139	166

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>B</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet ,no jack, no tools, with spare tire, with LTO plate</p>