

General Information

Date & Time: 04, Jun, 2025 14:06

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	92,097
Registration No.	NIG2132	Chassis No.	PA1B18F32N4197571
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



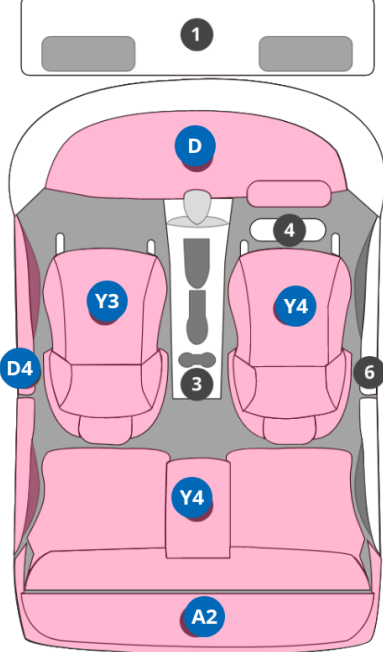
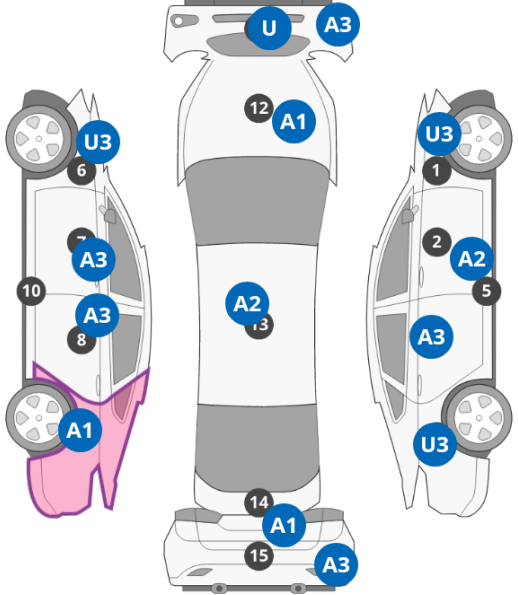
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	112	106	115
2	Boot Lid	105.4	106	93	117
3	Roof	101.9	107	99	100/102
4	Left Front Fender	99.6	102	94	103
5	Left Front Door	106.2	110	110	99
6	Center Panel Left				
7	Left Rear Door	107.6	108	107	108
8	Left Back Panel	188.0	183	194	187
9	Right Front Fender	97.8	99	95	100
10	Right Front Door	101.6	100	101	104
11	Center Panel Right				
12	Right Rear Door	109.3	112	104	112
13	Right Back Panel	116.3	107	112	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Trim - Worked - Large / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>		<p>Remarks (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Dent - Medium / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Dent - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes</p>	

Inspector Notes
with LTO plate, no warranty booklet, no jack and tools, with spare tire, busted plate light, busted dome light, no reverse camera, traces of adhesive on all doors