

## General Information

Date & Time: 02, Jun, 2025 15:06

<b>Make</b>	Suzuki	<b>Model</b>	Dzire
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	13,729
<b>Registration No.</b>	NFB2314	<b>Chassis No.</b>	MBHZF63S1RG370099
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



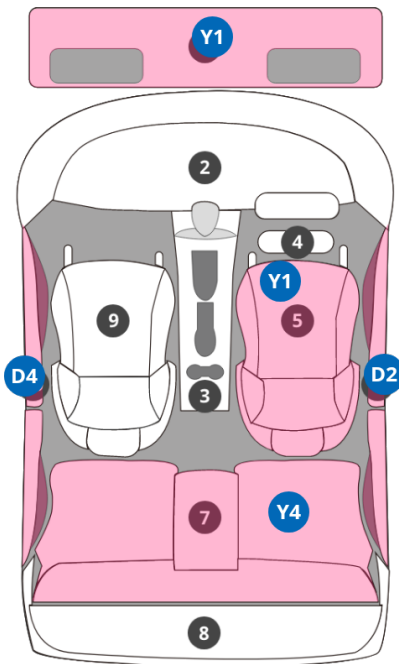
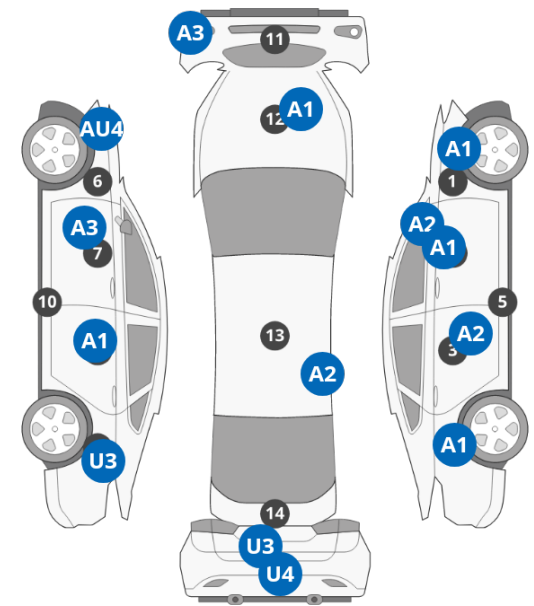
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.1	101	100	109
2	Boot Lid	88.9	97	85	84
3	Roof	107.0	98	97	117/116
4	Left Front Fender	98.0	88	107	99
5	Left Front Door	101.2	100	101	103
6	Center Panel Left				
7	Left Rear Door	97.6	108	98	87
8	Left Back Panel	100.8	105	101	97
9	Right Front Fender	97.6	98	103	92
10	Right Front Door	98.8	99	99	99
11	Center Panel Right				
12	Right Rear Door	95.8	86	99	102
13	Right Back Panel	110.7	96	104	132

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>  (R) Front Trim - Worked - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Large / (L) Front Trim - Worked - Large / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b>  (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Dent - Large / (L) Rear Fender, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch &amp; Dent - Large / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b>  Defects not found</p>	<p><b>Remarks</b>  Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with warranty booklet, with jack, no tools, with spare tire, no reverse camera</p>