

General Information

Date & Time: 30, May, 2025 14:42

Make	Toyota	Model	Hiace
YOM	2021	Odo Meter Reading	43,674
Registration No.	NGU3716	Chassis No.	JTFJT02P5L5026226
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



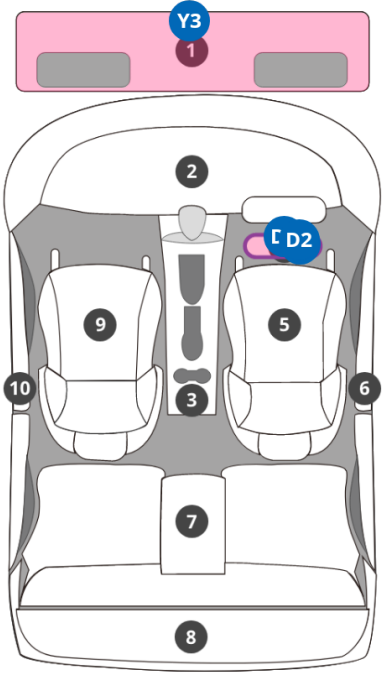
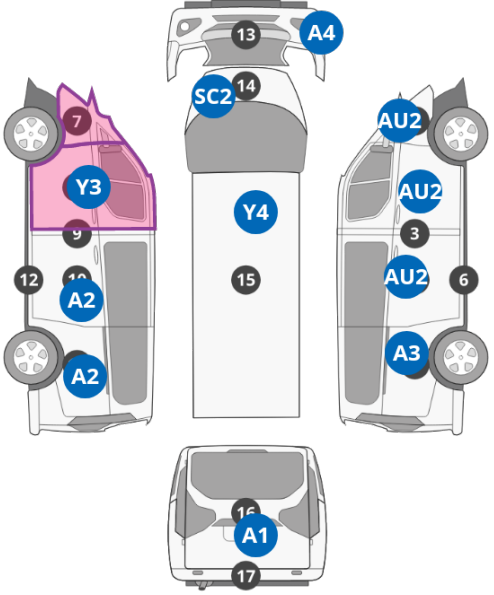
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	84.6	74	90	89
2	Boot Lid	82.1	89	82	76
3	Roof	77.3	78	74	73/84
4	Left Front Fender	364.3	189	557	347
5	Left Front Door	436.3	477	671	161
6	Center Panel Left	66.5	67	66	67
7	Left Rear Door				
8	Left Back Panel	72.3	76	73	68
9	Right Front Fender	84.4	81	86	87
10	Right Front Door	61.3	61	62	60
11	Center Panel Right	66.6	76	66	58
12	Right Rear Door	66.8	67	68	66
13	Right Back Panel	81.2	80	89	74

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Carpet - Worked - Minimal / Mat Other - Missing - Yes / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Windshield - Damaged - Large / Front Panel - Rust, Corrosion - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Crack, Gap - Medium / (L) Center Panel - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate and Jack, Sparetire and incomplete tools. no warranty booklet, crack head lights and scratch tail lights.</p>