

## General Information

Date & Time: 03, Jun, 2025 15:01

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	15,509
<b>Registration No.</b>	BAG3472	<b>Chassis No.</b>	MHFAA1BYOR0023242
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	White		

## Body / Panel Condition



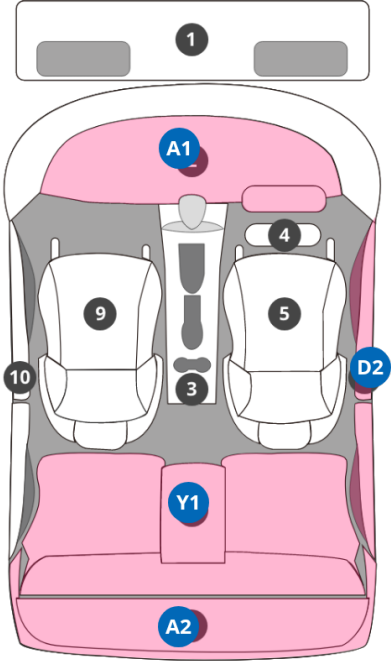
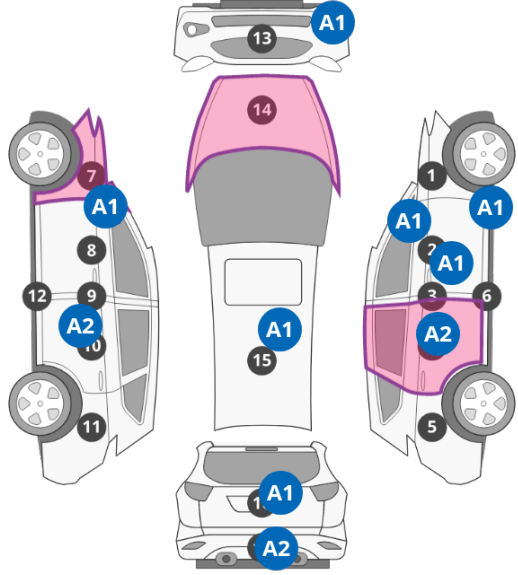
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.7	102	80	100
2	Boot Lid	91.6	90	91	94
3	Roof	100.9	99	97	103/105
4	Left Front Fender	96.9	109	92	90
5	Left Front Door	140.0	135	138	147
6	Center Panel Left				
7	Left Rear Door	111.3	114	105	115
8	Left Back Panel	112.2	109	98	130
9	Right Front Fender	137.6	134	138	141
10	Right Front Door	101.4	104	98	102
11	Center Panel Right				
12	Right Rear Door	143.6	141	139	151
13	Right Back Panel	99.7	92	91	117

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Minimal / (R) Front Trim - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Scratch - Minimal / Overall Exterior - Full Re-Paint in same color - Yes / (R) Rear Door, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Front Cross Member Support - Condition of Welding ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with warranty booklet, with jack and tools, with spare tire, rear tow hook cover missing, right rear door 1 bolt missing and 1 replaced, no reverse camera</p>