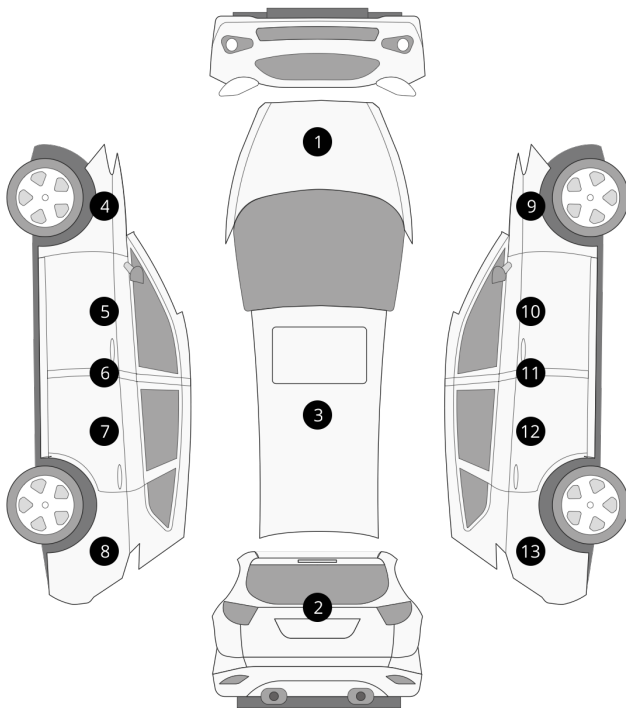


General Information

Date & Time: 26, May, 2025 08:52

Make	Toyota	Model	Hiace
YOM	2020	Mileage	161,417
Registration No.	NDM4559	Chassis No.	JTFJT02PXXK0013175
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



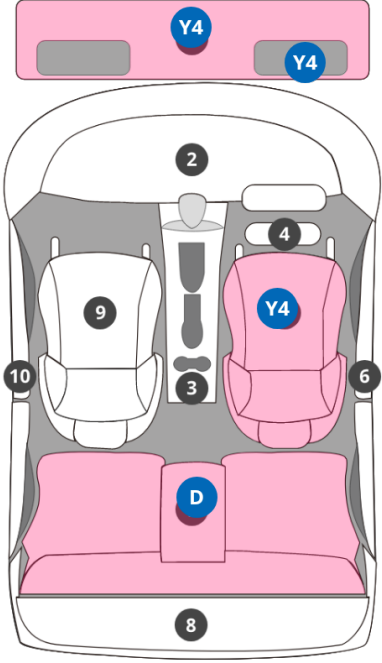
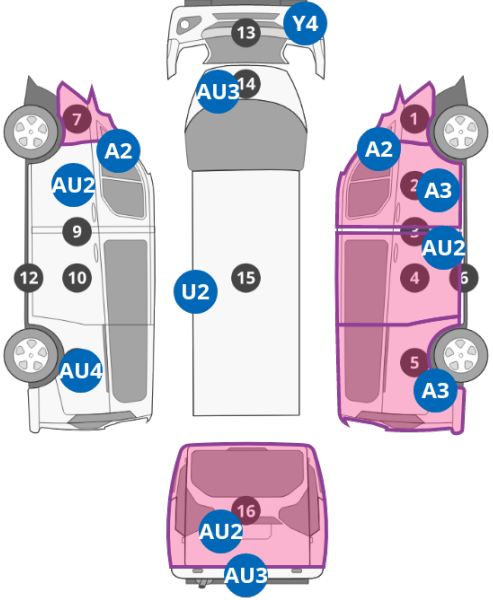
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	116	110	116
2	Boot Lid	234.0	187	224	291
3	Roof	107.7	101	105	110/115
4	Left Front Fender				
5	Left Front Door	133.0	112	138	149
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	167.6	164	177	162
9	Right Front Fender				
10	Right Front Door	113.0	106	117	116
11	Center Panel Right				
12	Right Rear Door	182.6	207	199	142
13	Right Back Panel	164.6	197	170	127

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Sunvisor, Sunglass Holder - Grime - Large / Ceiling - Grime - Large / Rear Seat - Worn - Yes	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Roof - Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Dead battery. left and right front fender repaired. Sliding door issue. Without warranty booklet and jack. With spare tire and tools. 1 key. Without LTO plate