

## General Information

Date & Time: 23, May, 2025 15:09

<b>Make</b>	Mitsubishi	<b>Model</b>	Montero SPT
<b>YOM</b>	2018	<b>Mileage</b>	58,870
<b>Registration No.</b>	NBR9007	<b>Chassis No.</b>	MMBOUKR10JH021712
<b>CC</b>	2.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	SUV
<b>Colour</b>	Silver		

## Body / Panel Condition



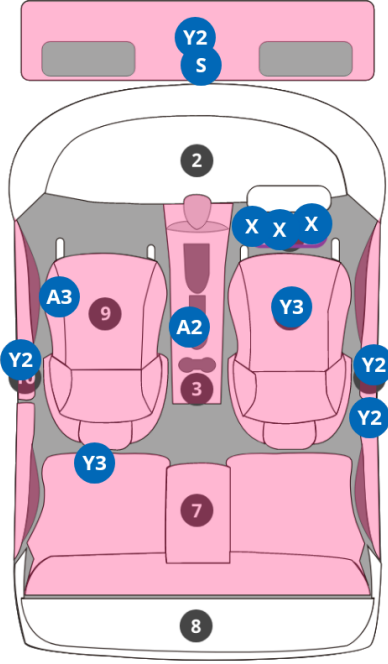
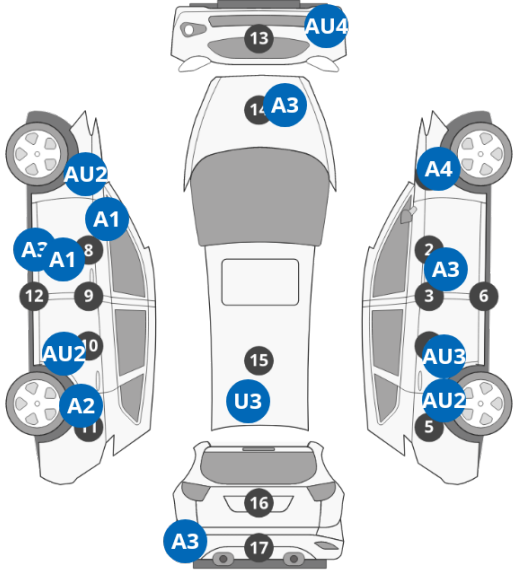
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.3	120	121	123
2	Boot Lid	103.3	102	107	101
3	Roof	98.6	92	99	103/101
4	Left Front Fender	143.3	153	135	142
5	Left Front Door	106.0	109	99	110
6	Center Panel Left				
7	Left Rear Door	123.6	123	122	126
8	Left Back Panel	127.0	126	134	121
9	Right Front Fender	126.4	99	119	161
10	Right Front Door	91.8	109	85	82
11	Center Panel Right				
12	Right Rear Door	93.4	88	86	106
13	Right Back Panel	141.0	131	140	152

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Cut, Crack - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Overall Interior - Smell - Yes</p>	<p><b>Remarks</b> Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Possible flooding. crack at front bumper. check engine light. maintenance warning lamp. With spare tire but without one tire. without warranty booklet, seat cover, jack and tools. one key. with LTO plate.</p>