

General Information

Date & Time: 04, Jun, 2025 15:14

Make	Suzuki	Model	Carry
YOM	2023	Odo Meter Reading	31,412
Registration No.	NIS8569	Chassis No.	MHYDC61TOPJ214474
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



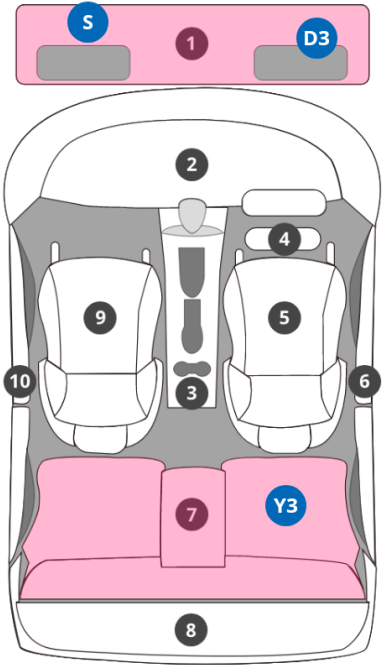
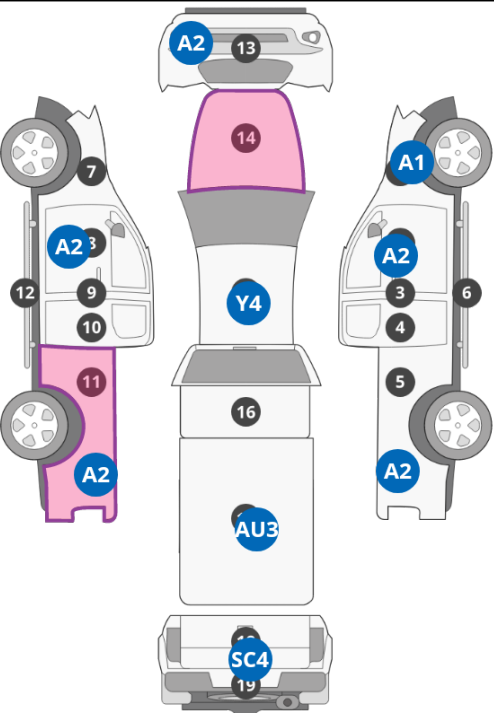
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	181.0	175	168	200
2	Boot Lid	168.6	162	164	180
3	Roof	106.4	105	105	127/89
4	Left Front Fender	122.0	119	126	121
5	Left Front Door	105.6	107	108	102
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	183.0	160	242	147
9	Right Front Fender	128.6	125	131	130
10	Right Front Door	107.0	109	112	100
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	161.3	166	178	140

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Ceiling - Crinkle - Medium / Rear Seat - Grime - Medium</p>	<p>Remarks Front Panel - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (L) Side Gate - Repair mark - Yes / Front Panel - Repair mark - Yes / (L) Side Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Rear Gate - Rust, Corrosion - Large / Roof - Scratch & Dent - Medium / (R) Side Gate - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Windshield - Damaged - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Wiper - Function - Weak</p>

<p>Inspector Notes</p>
<p>with LTO plate and Incomplete tools. No warranty booklet and sparetire, Jack. scratch tail lights and adhesive marks around the unit.</p>