

## General Information

Date & Time: 04, Jun, 2025 15:56

<b>Make</b>	Toyota	<b>Model</b>	Lite Ace
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	12,868
<b>Registration No.</b>	NHE7064	<b>Chassis No.</b>	MHKB3FE10PK002347
<b>CC</b>	1.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Van
<b>Colour</b>	White		

## Body / Panel Condition



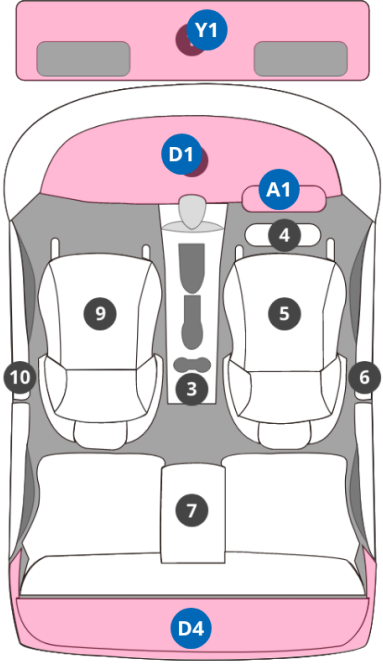
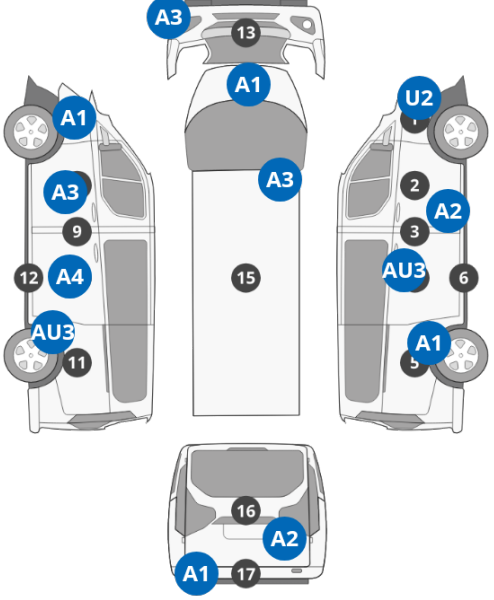
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	47.0	47	49	45
2	Boot Lid	52.8	45	70	44
3	Roof	57.8	60	52	60/60
4	Left Front Fender	48.1	43	50	52
5	Left Front Door	49.3	52	48	48
6	Center Panel Left	52.3	62	52	43
7	Left Rear Door	49.5	51	51	46
8	Left Back Panel	52.3	45	52	60
9	Right Front Fender	52.4	57	52	48
10	Right Front Door	51.8	46	49	60
11	Center Panel Right	47.9	49	51	43
12	Right Rear Door	55.6	52	54	60
13	Right Back Panel	49.6	50	47	52

**Overall Evaluation :**

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Trunk Room - Worked - Large / Glove Box - Worn, Scratch, Cut, Crack - Minimal / Dashboard - Worked - Minimal / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / Roof - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Front Panel - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with warranty booklet, no jack and tools, with spare tire</p>