

## General Information

Date & Time: 04, Jun, 2025 08:54

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	6,055
Registration No.	NHN6657	Chassis No.	PA1B18F32R4249111
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

## Body / Panel Condition



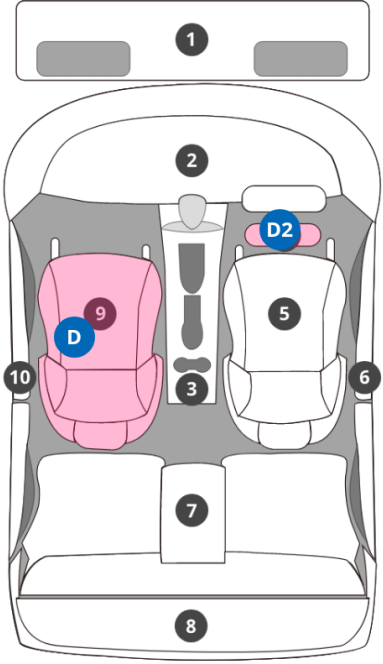
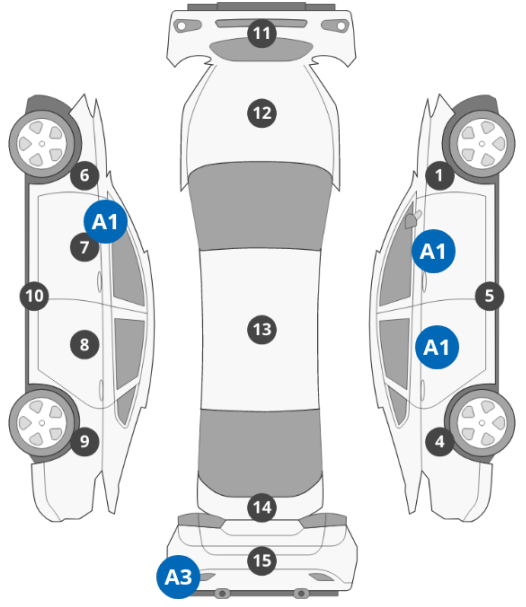
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	114	116	113
2	Boot Lid	103.0	102	102	105
3	Roof	103.8	107	109	98/101
4	Left Front Fender	96.2	95	97	98
5	Left Front Door	103.3	105	103	102
6	Center Panel Left				
7	Left Rear Door	103.3	106	101	103
8	Left Back Panel	111.6	123	111	101
9	Right Front Fender	104.9	105	100	110
10	Right Front Door	104.3	108	102	103
11	Center Panel Right				
12	Right Rear Door	102.8	98	101	110
13	Right Back Panel	111.0	109	108	116

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>B</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes</p>	<p><b>Remarks</b> (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Mirror - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Shift Shock - Function - Weak / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty, with jack and tools, with spare tire, with LTO plate, worn tires, engine and transmission abnormal noise and vibration</p>