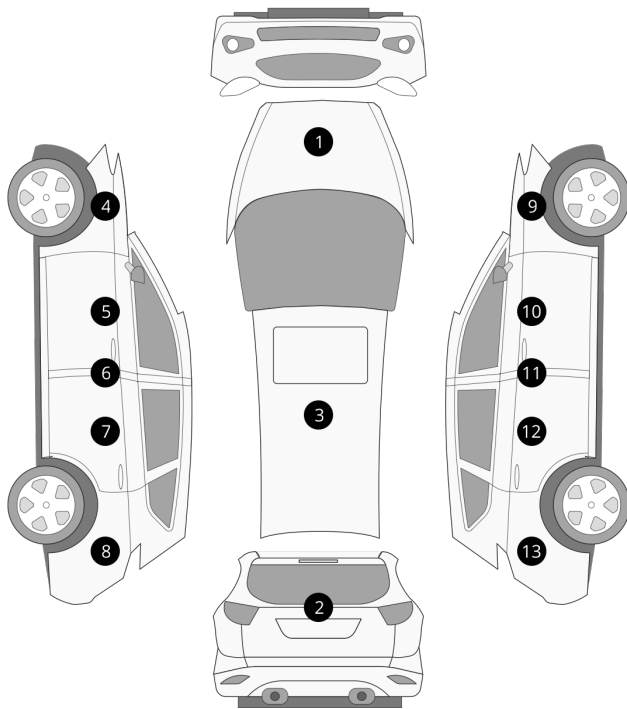


General Information

Date & Time: 31, May, 2025 09:11

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	118,434
Registration No.	NGT2314	Chassis No.	PA1B18F31L4132904
CC	1.3	Transmission	CVT
Fuel Type	Diesel	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



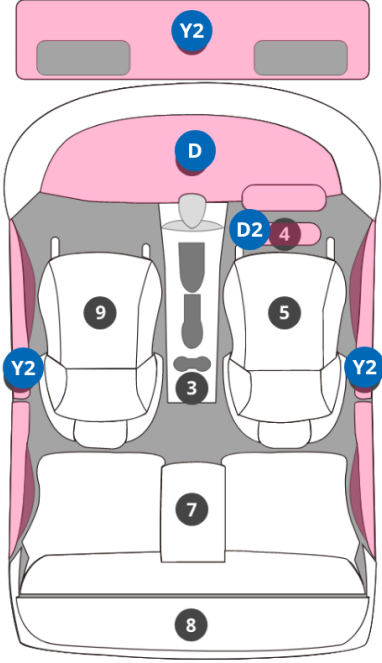
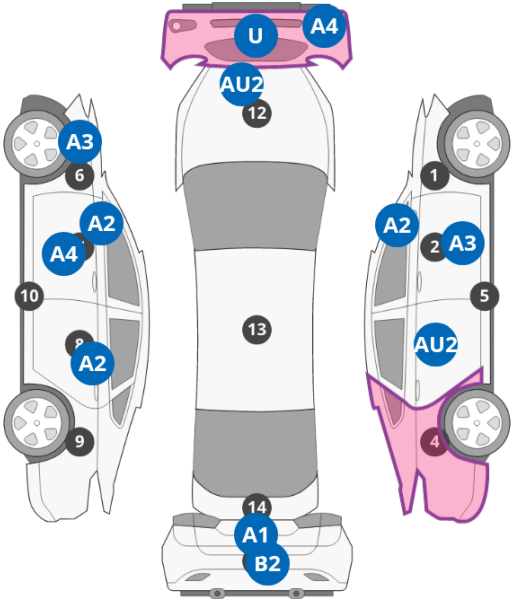
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.5	106	100	111
2	Boot Lid	154.3	153	141	169
3	Roof	91.3	102	86	91/86
4	Left Front Fender	85.2	84	84	87
5	Left Front Door	87.7	84	89	90
6	Center Panel Left				
7	Left Rear Door	89.8	94	90	86
8	Left Back Panel	203.0	176	249	184
9	Right Front Fender	265.0	154	151	490
10	Right Front Door	155.0	162	177	126
11	Center Panel Right				
12	Right Rear Door	141.6	142	145	138
13	Right Back Panel	208.0	206	206	212

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Wheel, Cover - Cap Missing - Yes / Rear Bumper, Lamps, Panels - Modified - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Left reverse light issue. without warranty booklet, jack and tools. With spare tire and seat cover. 1 key. With LTO plate