

General Information

Date & Time: 31, May, 2025 13:42

Make	Toyota	Model	Innova
YOM	2023	Odo Meter Reading	17,732
Registration No.	NIT4460	Chassis No.	PA2JA8EM0P0128924
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



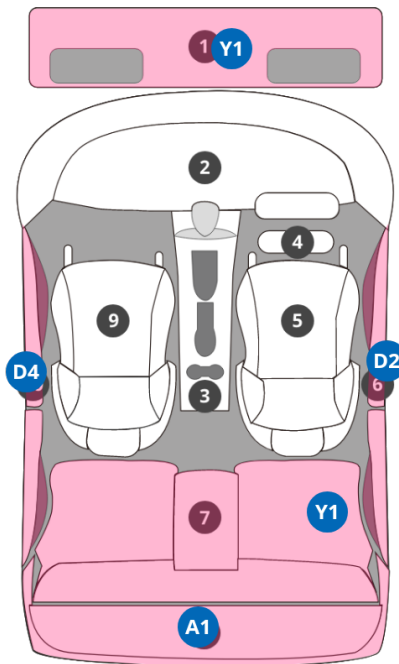
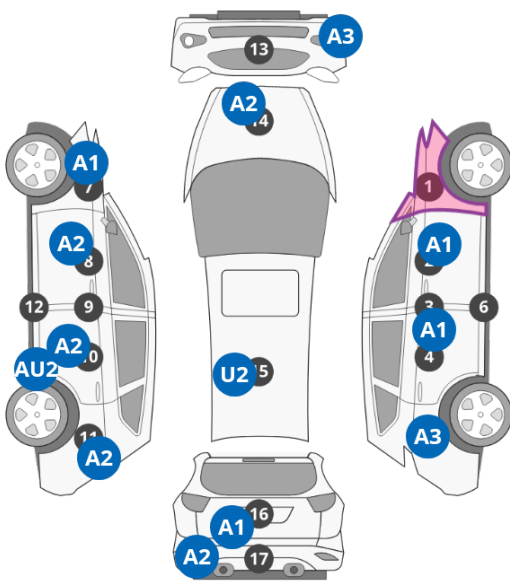
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	101	131	103
2	Boot Lid	103.0	107	102	100
3	Roof	105.8	99	118	111/96
4	Left Front Fender	100.8	95	96	111
5	Left Front Door	103.6	105	101	105
6	Center Panel Left				
7	Left Rear Door	104.3	110	104	99
8	Left Back Panel	108.3	105	108	112
9	Right Front Fender	234.6	218	229	257
10	Right Front Door	108.0	107	109	108
11	Center Panel Right				
12	Right Rear Door	110.3	108	107	116
13	Right Back Panel	113.3	107	114	119

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Minimal / (R) Front Trim - Worked - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Worked - Large / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / Roof - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, with jack and tools, with spare tire</p>