

## General Information

Date & Time: 03, Jun, 2025 10:41

<b>Make</b>	Toyota	<b>Model</b>	Raize
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	4,629
<b>Registration No.</b>	NHU3050	<b>Chassis No.</b>	MHKAB1BA6RJ097163
<b>CC</b>	1.2	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Gray		

## Body / Panel Condition



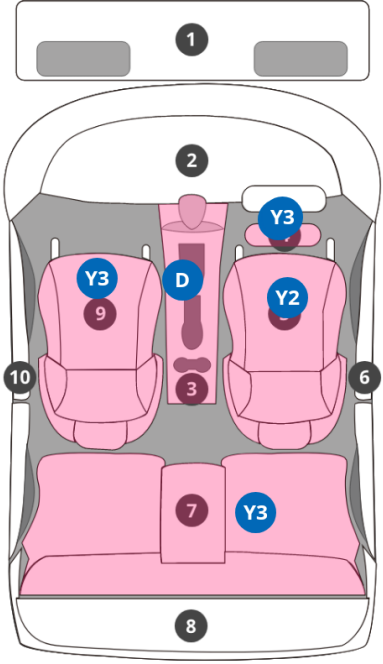
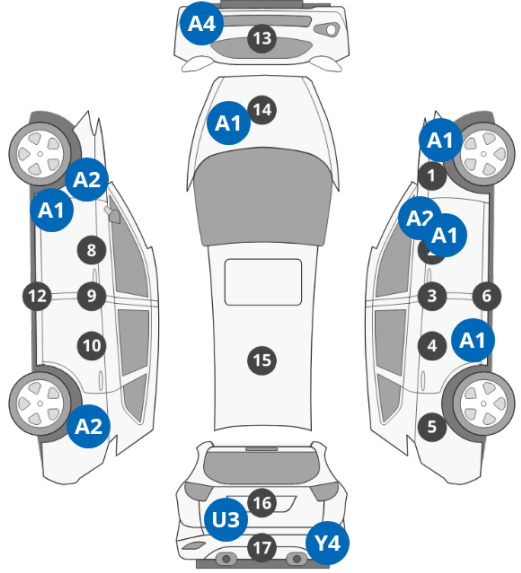
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	103	120	112
2	Boot Lid	87.1	79	100	83
3	Roof	110.7	99	119	112/113
4	Left Front Fender	95.6	87	111	89
5	Left Front Door	100.6	106	99	97
6	Center Panel Left				
7	Left Rear Door	97.6	99	100	95
8	Left Back Panel	92.7	95	87	96
9	Right Front Fender	88.7	88	93	85
10	Right Front Door	96.8	98	98	95
11	Center Panel Right				
12	Right Rear Door	96.0	87	100	101
13	Right Back Panel	85.8	90	83	84

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>  Rear Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Medium / Console, Switches, Vents - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Medium</p>	<p><b>Remarks</b>  (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b>  Defects not found</p>	<p><b>Remarks</b>  Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack, no tools, with spare tire, with LTO plate</p>