

General Information

Date & Time: 04, Jun, 2025 08:15

Make	Toyota	Model	Hilux
YOM	2022	Odo Meter Reading	51,422
Registration No.	NFG9407	Chassis No.	MR0JB8DD0M3186171
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



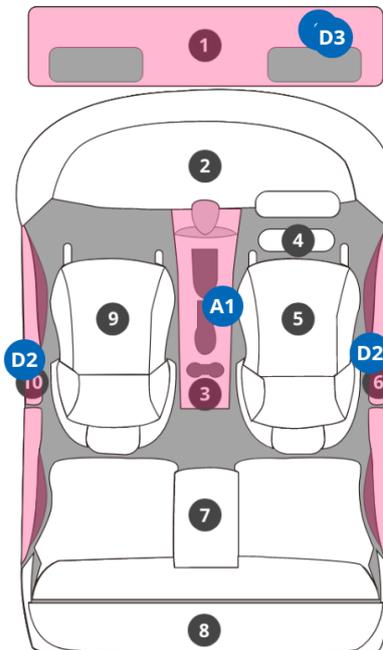
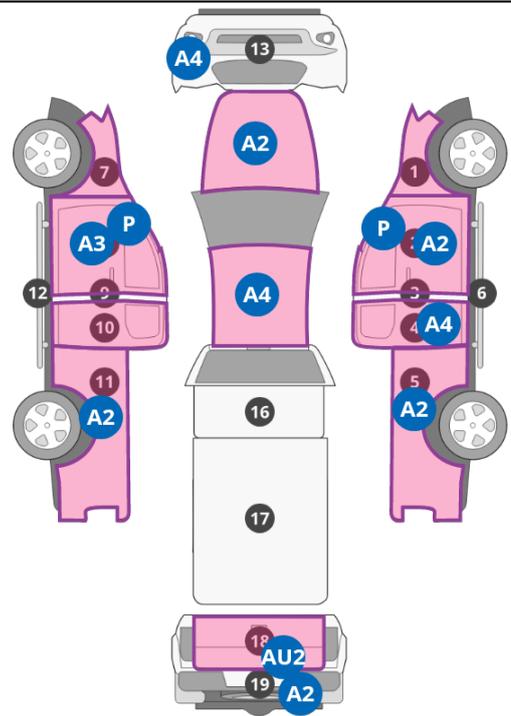
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	198.3	187	193	215
2	Boot Lid	287.6	491	192	180
3	Roof	323.7	151	175	797/172
4	Left Front Fender	1,033.3	797	1,126	1,177
5	Left Front Door	498.3	730	165	600
6	Center Panel Left				
7	Left Rear Door	244.6	146	140	448
8	Left Back Panel	489.0	566	745	156
9	Right Front Fender	710.3	236	1,204	691
10	Right Front Door	154.0	145	176	141
11	Center Panel Right				
12	Right Rear Door	320.6	515	278	169
13	Right Back Panel	822.0	510	785	1,171

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Ceiling - Crinkle - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Side Gate - Repair mark - Yes / (L) Side Gate - Repair mark - Yes / Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Side Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Partially Missing - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Partially Missing - Yes / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Faded(Color, Gloss) - Yes / (L) Mirror - Faded(Color, Gloss) - Yes / (R) Side Gate - Scratch - Small / Roof - Scratch - Large / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate and sparetire. no Tools and jack, no warranty booklet. scratches tail light and adhesive marks around the body of vehicle.</p>