

## General Information

Date & Time: 03, Jun, 2025 17:11

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	38,836
<b>Registration No.</b>	DBH9694-1	<b>Chassis No.</b>	PA2JA8EMXP0123844
<b>CC</b>	2.8	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



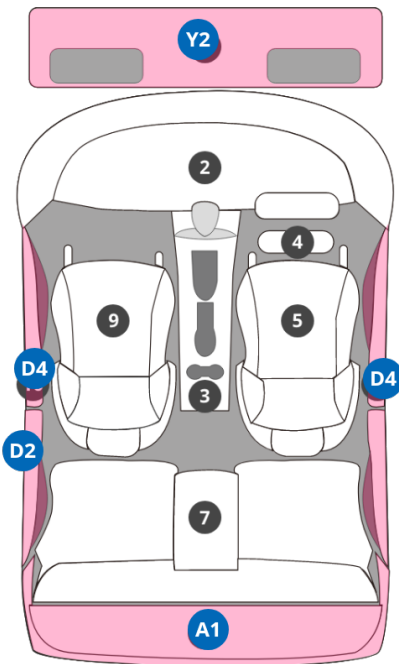
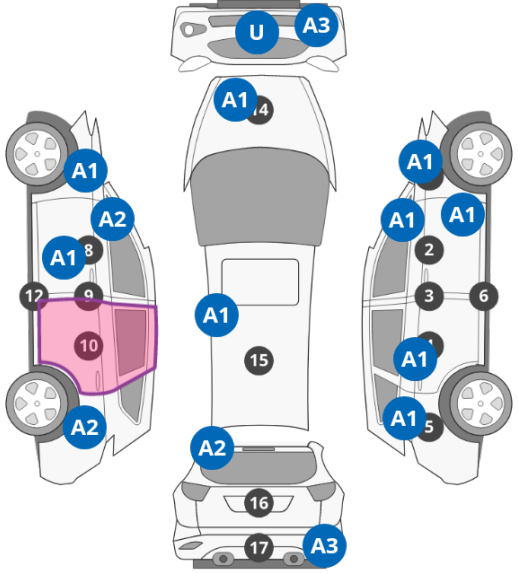
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.7	97	114	92
2	Boot Lid	100.3	101	93	107
3	Roof	97.4	99	104	95/92
4	Left Front Fender	104.8	100	110	105
5	Left Front Door	107.6	102	108	113
6	Center Panel Left				
7	Left Rear Door	217.0	214	196	241
8	Left Back Panel	117.0	120	112	119
9	Right Front Fender	106.6	109	111	100
10	Right Front Door	105.6	112	105	100
11	Center Panel Right				
12	Right Rear Door	109.0	104	105	118
13	Right Back Panel	114.6	112	109	123

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	C	<b>Exterior Evaluation :</b>	C
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Rear Trim - Worked - Small / Ceiling - Grime - Small / (R) Front Trim - Worked - Large / (L) Front Trim - Worked - Large</p>		<p><b>Remarks</b> (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>	
<b>Frame Evaluation :</b>	A	<b>Functional Evaluation :</b>	A
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Horn - Issue - Yes / Spare Key - Issue - Unexist</p>	

<b>Inspector Notes</b>
with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire,