

## General Information

Date & Time: 03, Jun, 2025 17:54

|                         |                   |                          |                   |
|-------------------------|-------------------|--------------------------|-------------------|
| <b>Make</b>             | Toyota            | <b>Model</b>             | Vios              |
| <b>YOM</b>              | 2023              | <b>Odo Meter Reading</b> | 38,189            |
| <b>Registration No.</b> | NFP7910-1         | <b>Chassis No.</b>       | PA1B18F32N4194301 |
| <b>CC</b>               | 1.3               | <b>Transmission</b>      | CVT               |
| <b>Fuel Type</b>        | Gas               | <b>Type of Body</b>      | Sedan             |
| <b>Colour</b>           | Red Mica Metallic |                          |                   |

## Body / Panel Condition



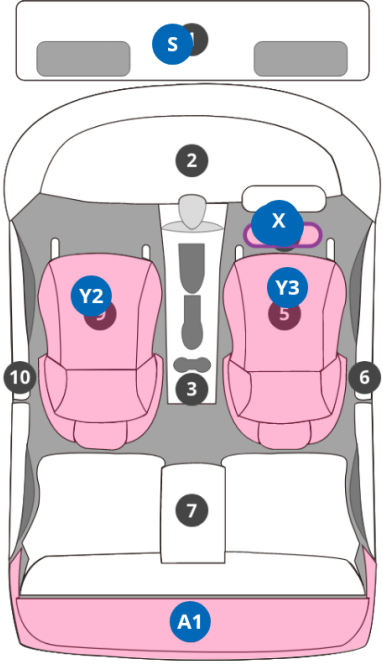
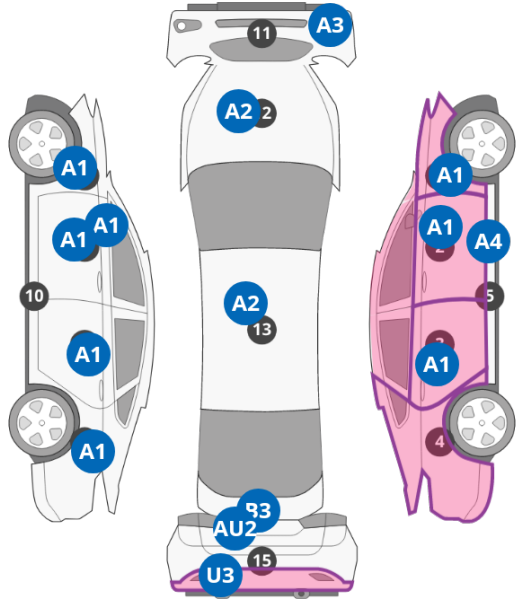
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 105.5         | 112    | 93     | 112      |
| 2  | Boot Lid           | 103.5         | 96     | 99     | 115      |
| 3  | Roof               | 85.8          | 83     | 82     | 86/92    |
| 4  | Left Front Fender  | 92.3          | 95     | 90     | 93       |
| 5  | Left Front Door    | 90.2          | 88     | 92     | 91       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 111.3         | 113    | 120    | 101      |
| 8  | Left Back Panel    | 93.8          | 100    | 90     | 92       |
| 9  | Right Front Fender | 96.8          | 97     | 95     | 99       |
| 10 | Right Front Door   | 92.7          | 95     | 91     | 92       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 95.0          | 88     | 100    | 98       |
| 13 | Right Back Panel   | 95.3          | 92     | 94     | 100      |

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|  |   |
|--|---|
| <b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>   | <b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>  |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                     |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>   |
| <p><b>Remarks</b><br/>Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Overall Interior - Smell - Yes / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Medium</p> | <p><b>Remarks</b><br/>(R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Modified - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Dent - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small</p> |
| <b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>  | <b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>  |
| <p><b>Remarks</b><br/>Defects not found</p>  | <p><b>Remarks</b><br/>Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>  |

|   |
|---|
| <p><b>Inspector Notes</b></p>   |
| <p>with LTO plate, no warranty booklet, no jack, incomplete tools, no spare tire, stain and scratches on tail light, drill marks on trunk hood, no reverse camera</p> |