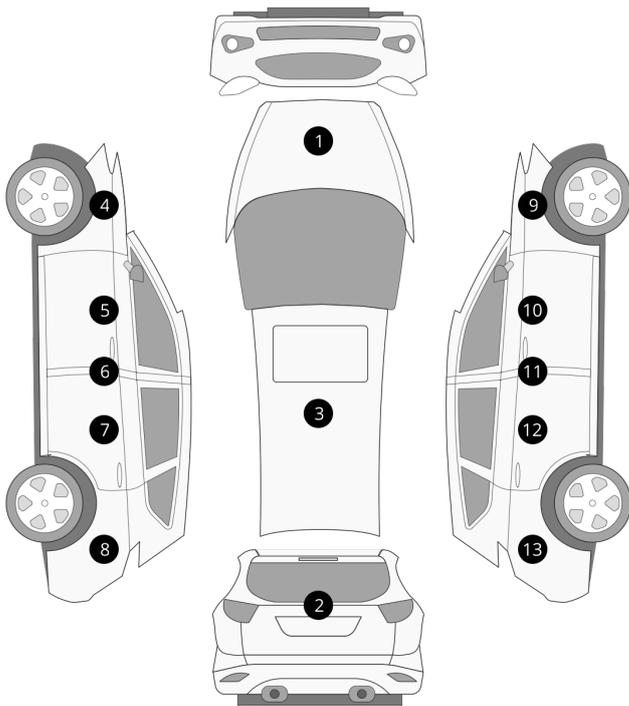


## General Information

Date & Time: 19, Jun, 2025 10:55

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2017	<b>Odo Meter Reading</b>	132,135
<b>Registration No.</b>	CAC2512	<b>Chassis No.</b>	PA2GA8EM5G0016078
<b>CC</b>	2.8	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	MPV
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



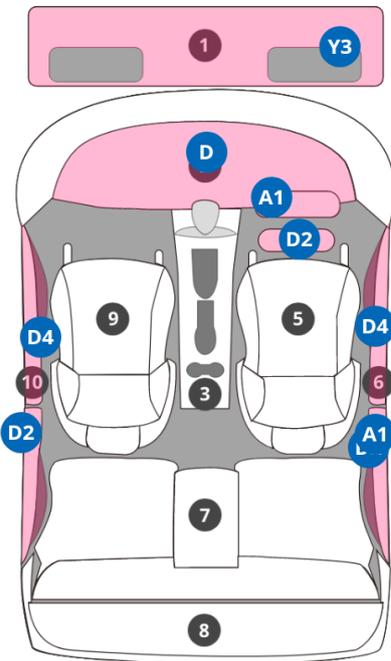
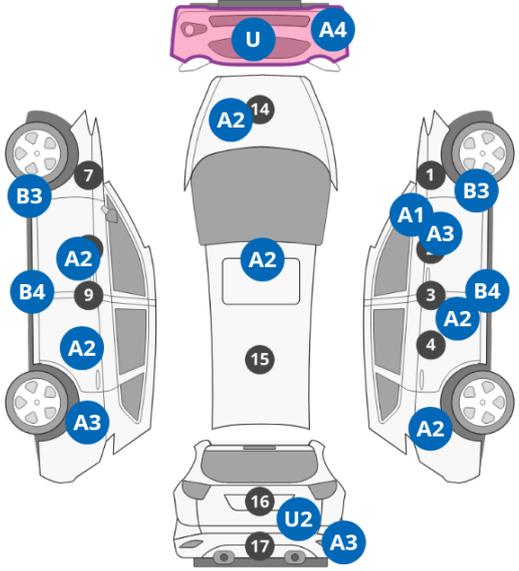
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	118	116	103
2	Boot Lid	210.3	211	208	212
3	Roof	96.3	99	106	85/95
4	Left Front Fender	176.3	197	178	154
5	Left Front Door	91.9	98	93	85
6	Center Panel Left				
7	Left Rear Door	91.9	105	85	86
8	Left Back Panel	96.2	97	99	93
9	Right Front Fender	142.6	130	152	146
10	Right Front Door	122.6	113	132	123
11	Center Panel Right				
12	Right Rear Door	86.3	86	88	85
13	Right Back Panel	97.0	92	98	101

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / (R) Rear Trim - Worked - Small / (L) Rear Trim - Worked - Small / (R) Front Trim - Worked - Large / (L) Front Trim - Worked - Large / (R) Rear Trim - Cut, Crack - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Modified - Large / (L) Step, In-panel, Side Spoiler - Modified - Large / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Modified - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Modified - Medium / (L) Front Door, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate</p>