

## General Information

Date & Time: 05, Jun, 2025 14:02

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	8,442
<b>Registration No.</b>	NFJ4059	<b>Chassis No.</b>	PA1B18F35N4172373
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blackish Red Mica		

## Body / Panel Condition



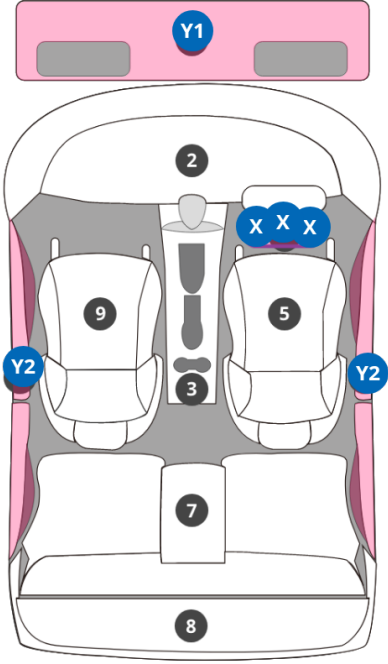
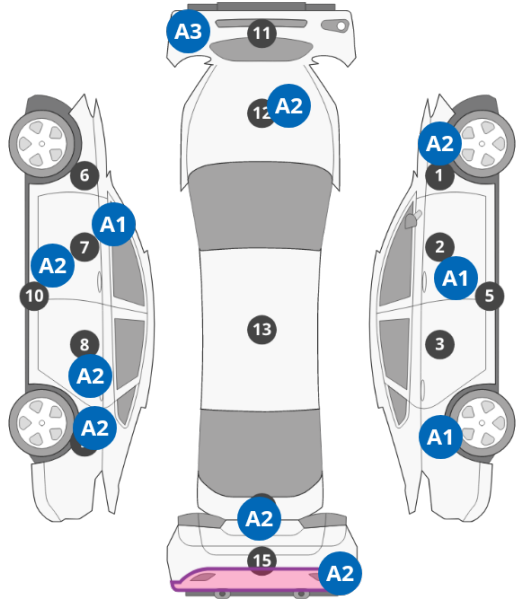
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	112	115	125
2	Boot Lid	107.6	104	106	113
3	Roof	98.2	109	92	95/98
4	Left Front Fender	156.3	145	177	147
5	Left Front Door	104.6	111	108	95
6	Center Panel Left				
7	Left Rear Door	110.6	109	110	113
8	Left Back Panel	105.4	109	99	108
9	Right Front Fender	98.6	98	101	97
10	Right Front Door	100.3	100	101	100
11	Center Panel Right				
12	Right Rear Door	103.6	107	100	104
13	Right Back Panel	102.4	102	95	110

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (L) Front Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet, tools, and jack. With spare tire and leather seat cover. 1 key. with LTO plate</p>