

General Information

Date & Time: 05, Jun, 2025 18:27

Make	Toyota	Model	Hiace
YOM	2024	Odo Meter Reading	6,875
Registration No.	NHM3729	Chassis No.	JTFJT02P5035658
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



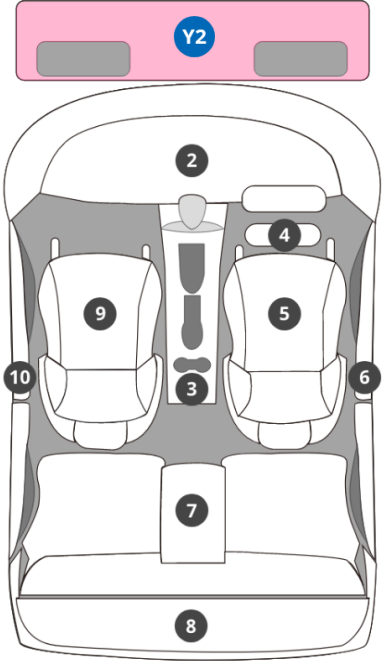
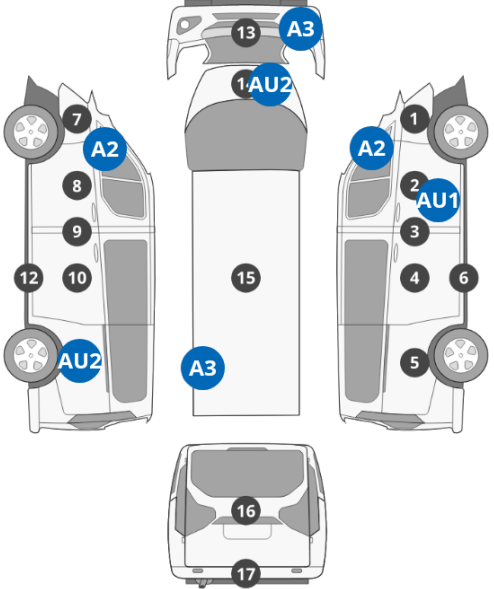
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	76.1	73	81	74
2	Boot Lid	73.8	71	77	73
3	Roof	71.4	65	75	70/76
4	Left Front Fender	80.1	81	77	82
5	Left Front Door	65.5	66	61	69
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	66.7	62	66	73
9	Right Front Fender	84.7	87	84	84
10	Right Front Door	64.8	67	59	69
11	Center Panel Right				
12	Right Rear Door	91.8	122	86	67
13	Right Back Panel	83.7	78	70	103

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Small	Remarks (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
Without warranty booklet, jack and tools. With spare tire. 2 keys. Not an LTO plate.