

General Information

Date & Time: 13, Jun, 2025 09:54

Make	Suzuki	Model	Carry
YOM	2023	Odo Meter Reading	38,219
Registration No.	NHE6929	Chassis No.	MHYDC61TXPJ213509
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



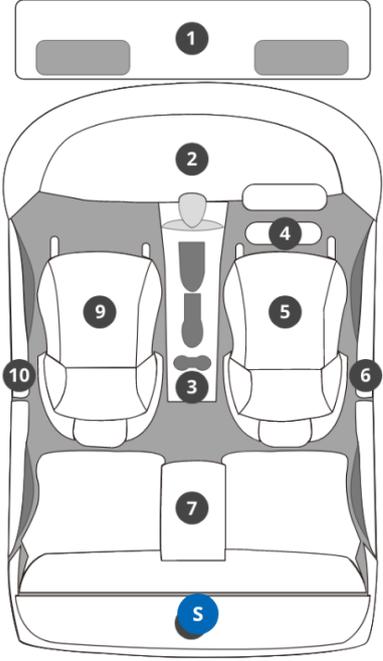
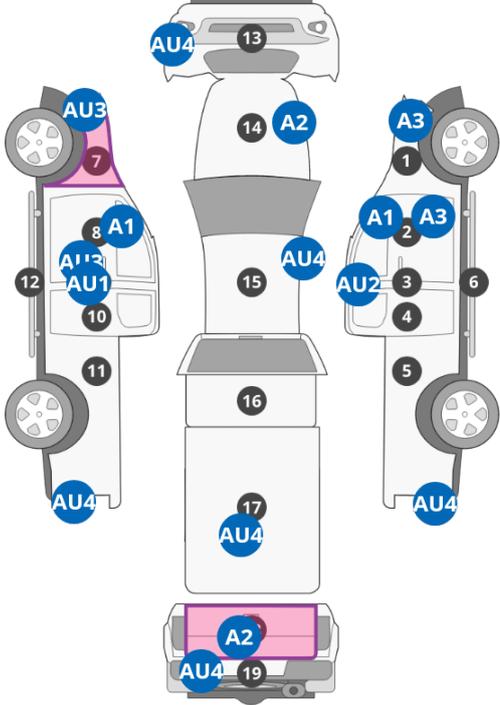
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	129	111	116
2	Boot Lid	134.6	103	141	160
3	Roof	107.5	114	113	106/97
4	Left Front Fender	137.6	131	149	133
5	Left Front Door	104.6	106	110	98
6	Center Panel Left	113.0	124	111	104
7	Left Rear Door				
8	Left Back Panel	181.3	176	203	165
9	Right Front Fender	117.6	109	121	123
10	Right Front Door	103.2	106	108	96
11	Center Panel Right	105.7	109	111	97
12	Right Rear Door				
13	Right Back Panel	189.0	176	208	183

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes</p>	<p>Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / Rear Gate - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Center Panel - Scratch & Dent - Small / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Gate - Scratch - Small / Cargo Bed Floor - Scratch & Dent - Large / (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Front Panel - Scratch - Small / (L) Center Panel - Scratch & Dent - Minimal / Roof - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, cracked headlight and tail light, headlight issue</p>