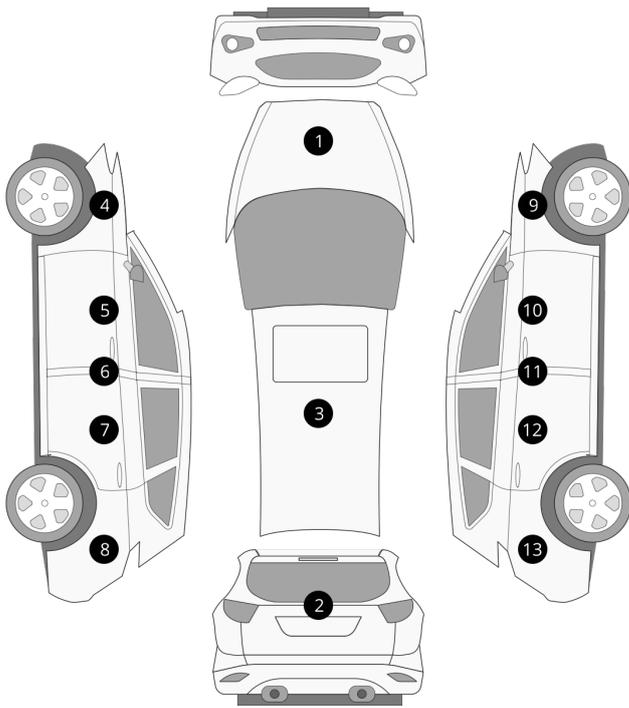


General Information

Date & Time: 11, Jun, 2025 14:46

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	26,462
Registration No.	NHR1951	Chassis No.	PA1B18F30P4226438
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



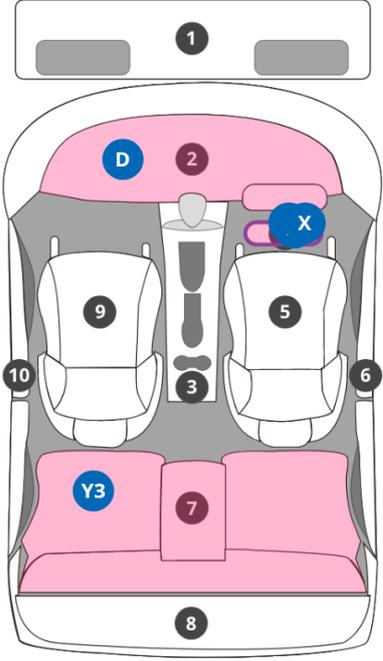
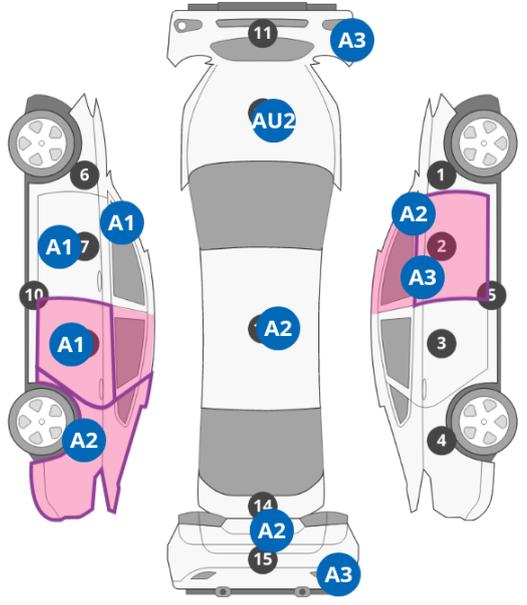
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	144.6	142	149	143
2	Boot Lid	103.6	100	108	103
3	Roof	97.2	107	94	92/96
4	Left Front Fender	580.0	585	683	472
5	Left Front Door	158.0	172	153	149
6	Center Panel Left				
7	Left Rear Door	101.3	109	99	96
8	Left Back Panel	105.0	109	105	101
9	Right Front Fender	168.6	158	182	166
10	Right Front Door	94.1	94	94	95
11	Center Panel Right				
12	Right Rear Door	143.0	141	139	149
13	Right Back Panel	104.3	102	97	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With temporary LTO plate and sparetire. no Tools and jack, warranty booklet. adhesive marks on body, scratch headlight and tail light.</p>