

General Information

Date & Time: 18, Jun, 2025 10:14

Make	Honda	Model	City
YOM	2019	Odo Meter Reading	127,670
Registration No.	NEH5137	Chassis No.	PADGM6620KV517993
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



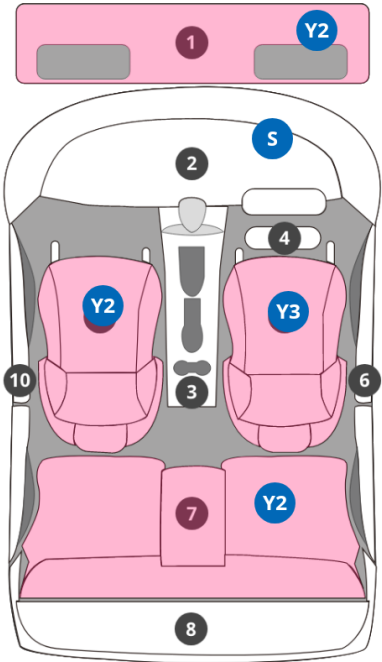
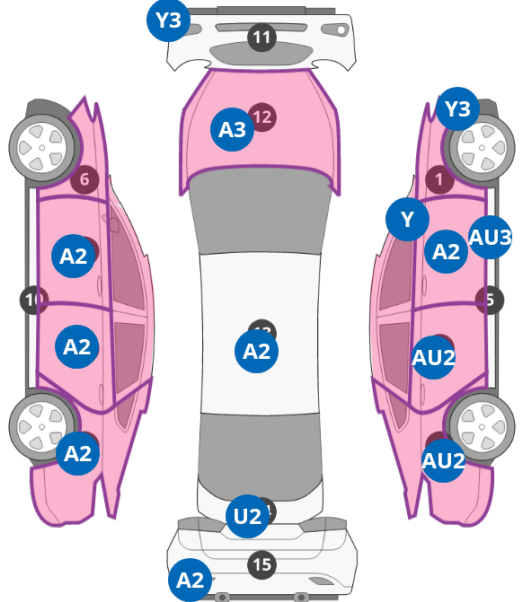
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	179.6	182	204	153
2	Boot Lid	113.0	113	108	118
3	Roof	80.1	79	82	82/78
4	Left Front Fender	124.0	118	118	136
5	Left Front Door	190.3	156	163	252
6	Center Panel Left				
7	Left Rear Door	193.6	242	174	165
8	Left Back Panel	134.3	154	133	116
9	Right Front Fender	173.6	198	162	161
10	Right Front Door	175.0	170	169	186
11	Center Panel Right				
12	Right Rear Door	280.3	265	252	324
13	Right Back Panel	150.0	127	159	164

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Ceiling - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Front Wheel, Cover - Cap Missing - Yes / (R) Front Wheel, Cover - Cap Missing - Yes / (R) Rear Wheel, Cover - Cap Missing - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Mirror - Crack - Damaged
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Jack, Sparetire and incomplete tools. no warranty booklet, scratch and faded headlight, scratch tail light.