

General Information

Date & Time: 07, Jun, 2025 15:17

Make	Nissan	Model	NV350
YOM	2017	Odo Meter Reading	78,558
Registration No.	NAR1823	Chassis No.	JN1TC2E26Z0011872
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



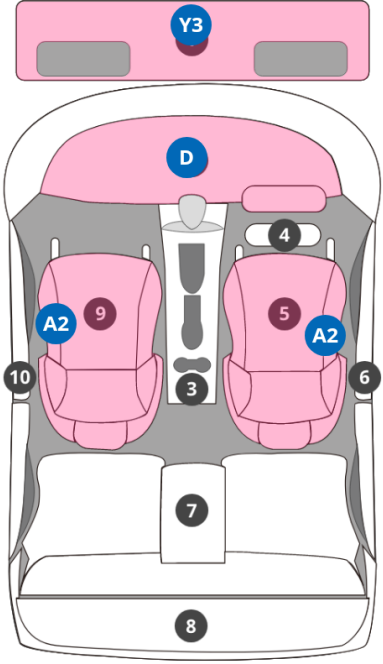
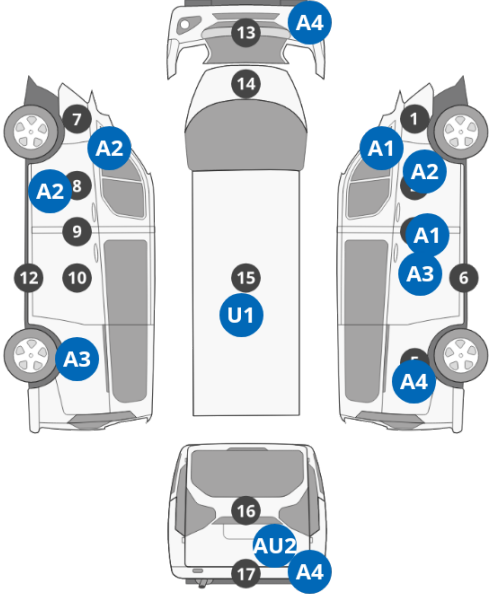
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	236.3	330	173	206
2	Boot Lid	321.3	305	294	365
3	Roof	132.6	174	153	93/110
4	Left Front Fender	196.0	164	211	213
5	Left Front Door	257.3	253	270	249
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	221.0	195	238	230
9	Right Front Fender	276.0	246	290	292
10	Right Front Door	216.0	171	198	279
11	Center Panel Right				
12	Right Rear Door	169.6	179	146	184
13	Right Back Panel	234.6	406	146	152

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Seat - Cut, Crack - Small / (L) Front Seat - Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>right taillight loose. low battery. without warranty booklet and tools. with spare tire and jack. 1 key. with LTO plate.</p>