

General Information

Date & Time: 07, Jun, 2025 07:58

Make	Toyota	Model	Wigo
YOM	2018	Odo Meter Reading	47,330
Registration No.	DAD2643	Chassis No.	MHKA4DF5FJJ020068
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



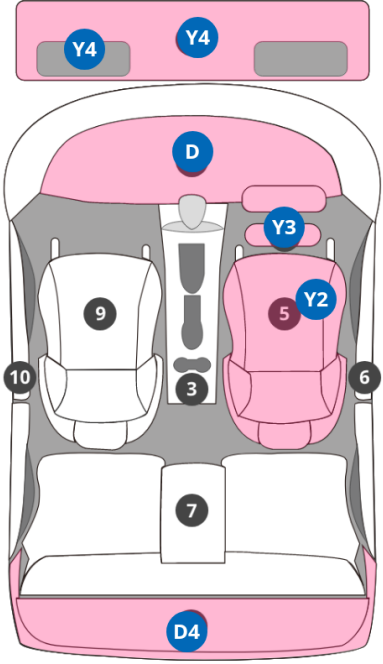
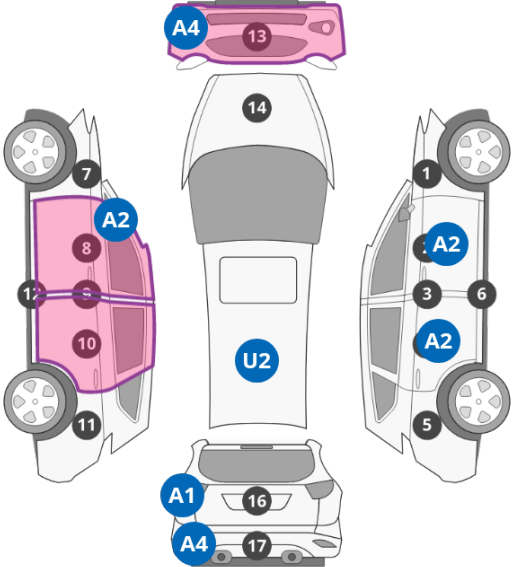
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.7	100	103	100
2	Boot Lid	83.1	81	87	81
3	Roof	64.9	59	72	62/66
4	Left Front Fender	98.3	95	104	96
5	Left Front Door	196.6	125	283	182
6	Center Panel Left				
7	Left Rear Door	232.3	379	156	162
8	Left Back Panel	122.6	144	115	109
9	Right Front Fender	82.8	78	85	85
10	Right Front Door	78.9	77	85	75
11	Center Panel Right				
12	Right Rear Door	77.8	76	78	80
13	Right Back Panel	83.2	90	80	81

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Sunvisor, Sunglass Holder - Grime - Large / Ceiling - Grime - Large / (R) Front Seat - Grime - Small / Trunk Room - Loose, Deformed - Large / Mat Other - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / Roof - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (L) Mirror - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Aircon issue. Shift lock issue. rear right signal light issue. Gap at front and rear bumper. trunk lever issue. Without warranty booklet and seat cover. with spare tire, jack and incomplete tools. 1 key. With LTO plate.</p>