

## General Information

Date & Time: 07, Jun, 2025 17:18

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	52,009
<b>Registration No.</b>	NBQ8310	<b>Chassis No.</b>	PA1B13F34K4080346
<b>CC</b>	1.3	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



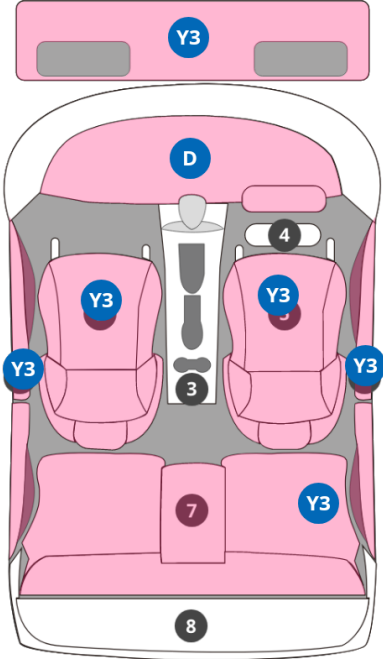
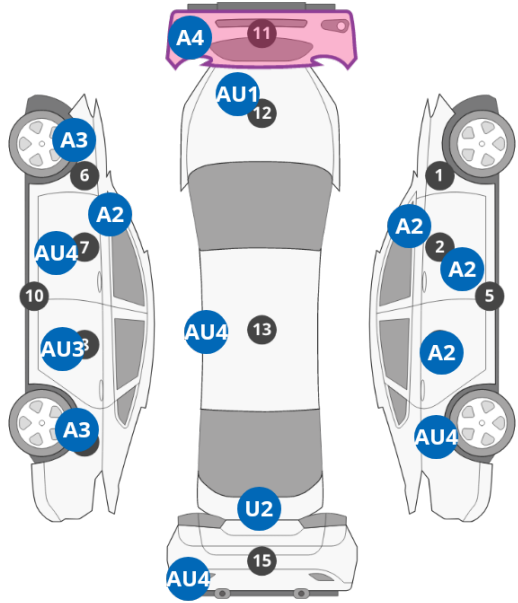
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.7	98	103	104
2	Boot Lid	113.6	110	118	113
3	Roof	88.6	89	82	93/92
4	Left Front Fender	93.7	97	93	91
5	Left Front Door	97.5	96	98	99
6	Center Panel Left				
7	Left Rear Door	123.3	125	123	122
8	Left Back Panel	217.3	162	284	206
9	Right Front Fender	145.3	153	146	137
10	Right Front Door	142.6	148	139	141
11	Center Panel Right				
12	Right Rear Door	147.0	136	141	164
13	Right Back Panel	150.3	150	141	160

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (L) Rear Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / Bonnet, Headlight - Scratch &amp; Dent - Minimal / Roof - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet, jack and tools. With spare tire. 1 key. with LTO plate.</p>