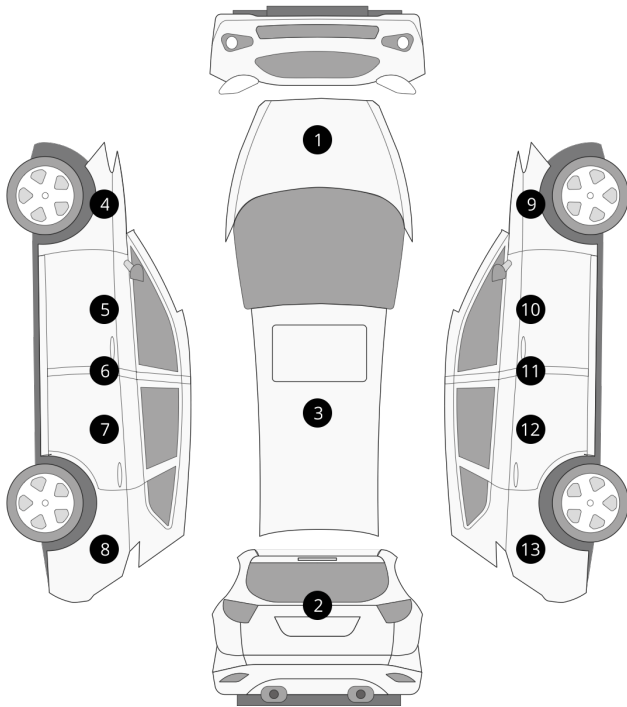


General Information

Date & Time: 09, Jun, 2025 12:57

Make	Toyota	Model	Vios
YOM	2018	Odo Meter Reading	63,909
Registration No.	BAA2259	Chassis No.	PA1B19F34J4060843
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



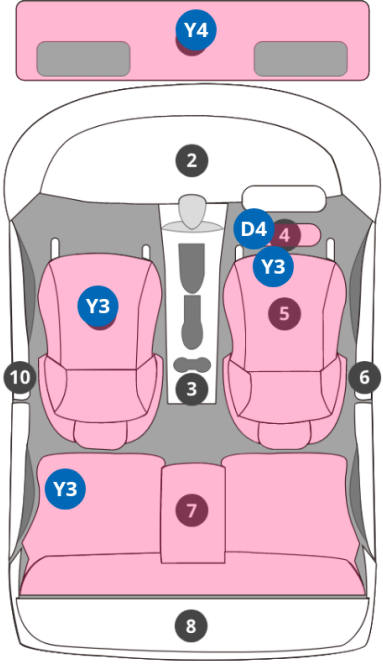
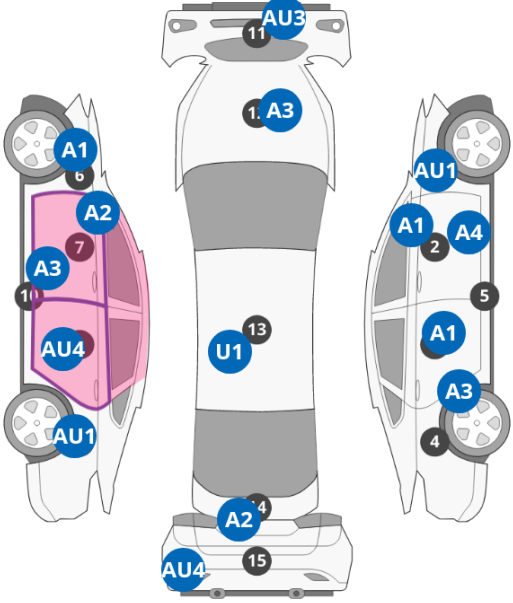
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	111	106	108
2	Boot Lid	207.3	182	219	221
3	Roof	108.5	103	112	112/107
4	Left Front Fender	168.3	164	171	170
5	Left Front Door	255.3	293	216	257
6	Center Panel Left				
7	Left Rear Door	108.0	111	108	105
8	Left Back Panel	172.3	198	155	164
9	Right Front Fender	107.6	113	109	101
10	Right Front Door	114.0	110	117	115
11	Center Panel Right				
12	Right Rear Door	113.0	120	111	108
13	Right Back Panel	114.3	114	113	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Large / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Carpet - Worked - Large</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Medium / (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet, seat cover and tools. With spare tire and jack. 1 key. with LTO plate</p>