

## General Information

Date & Time: 09, Jun, 2025 08:56

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	40,964
<b>Registration No.</b>	NGR8952	<b>Chassis No.</b>	MHKM5EE1FLK007124
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Gray		

## Body / Panel Condition



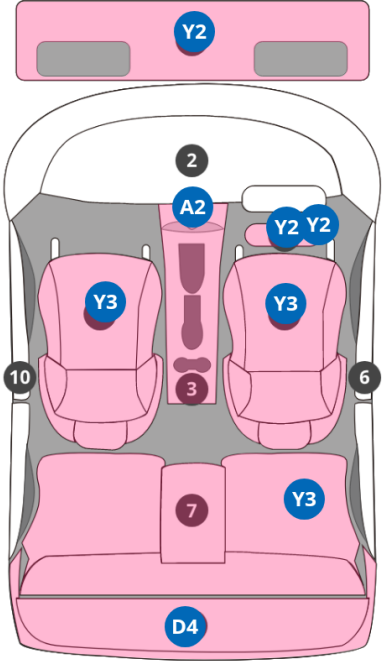
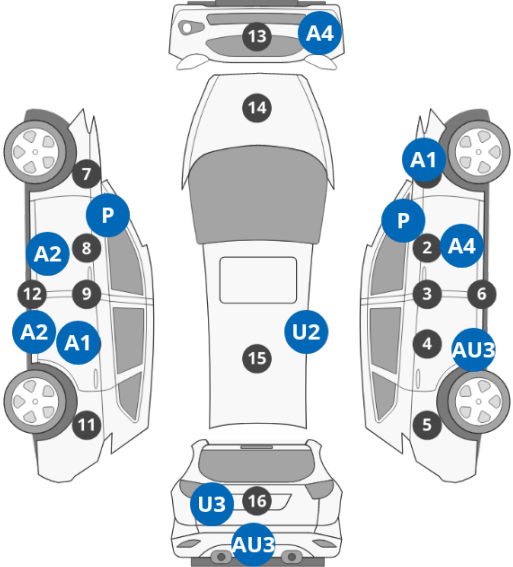
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	165.3	174	178	144
2	Boot Lid	99.8	100	100	100
3	Roof	87.7	80	84	98/89
4	Left Front Fender	89.8	88	90	92
5	Left Front Door	98.8	105	101	90
6	Center Panel Left				
7	Left Rear Door	97.8	97	96	101
8	Left Back Panel	77.6	67	80	86
9	Right Front Fender	96.2	100	97	92
10	Right Front Door	97.1	93	98	100
11	Center Panel Right				
12	Right Rear Door	129.3	136	129	123
13	Right Back Panel	142.0	127	136	163

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>  (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Ceiling - Grime - Small / Trunk Room - Loose, Deformed - Large / Mat Other - Grime - Small / (L) Front Seat - Grime - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b>  Bonnet - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Mirror - Faded(Color, Gloss) - Yes / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch - Large / Roof - Dent - Small / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b>  Defects not found</p>	<p><b>Remarks</b>  Door Lock - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet, spare tire and tools. Without jack and seat cover. 1 key. with LTO plate.</p>