

General Information

Date & Time: 09, Jun, 2025 10:55

Make	Nissan	Model	NV350
YOM	2018	Odo Meter Reading	78,459
Registration No.	NBM6134	Chassis No.	JNT1C2E26Z0051226
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



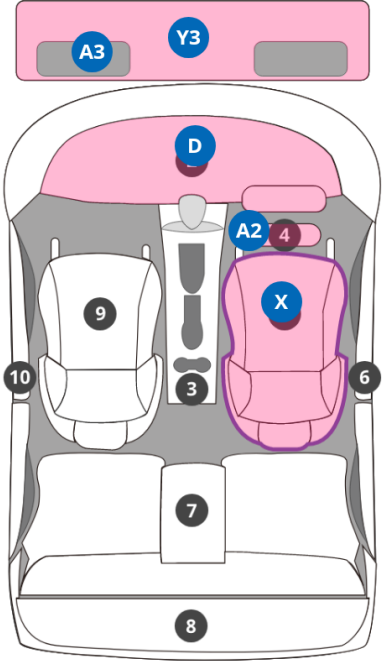
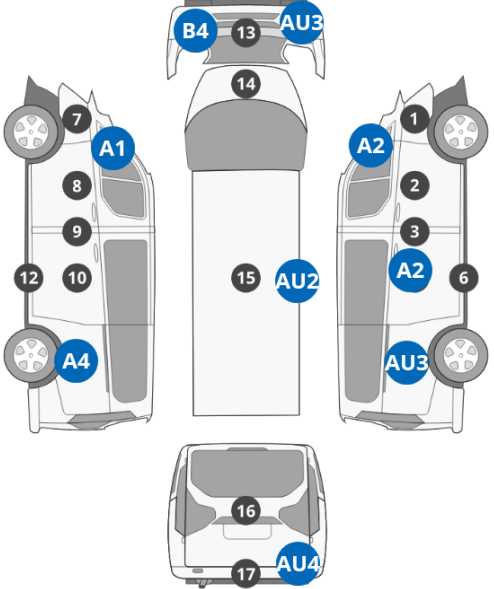
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	284.6	222	358	274
2	Boot Lid	209.6	259	202	168
3	Roof	118.7	284	74	57/59
4	Left Front Fender	184.3	222	178	153
5	Left Front Door	163.0	184	145	160
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	200.6	163	181	258
9	Right Front Fender	166.6	160	170	170
10	Right Front Door	131.6	137	137	121
11	Center Panel Right				
12	Right Rear Door	154.6	143	180	141
13	Right Back Panel	301.3	313	297	294

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Partially Missing - Yes / (L) Front Floor Mat - Cut, Crack - Small / Sunvisor, Sunglass Holder - Cut, Crack - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Modified - Large / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>park light and tail light issue. scratch at right taillight. with warranty booklet and seat cover. without spare tire, jack and tools. 1 key, with LTO plate.</p>