

## General Information

Date & Time: 09, Jun, 2025 09:52

<b>Make</b>	Nissan	<b>Model</b>	NV350
<b>YOM</b>	2016	<b>Odo Meter Reading</b>	90,232
<b>Registration No.</b>	ACS1884	<b>Chassis No.</b>	JN1TC2E26Z0004898
<b>CC</b>	2.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	White		

## Body / Panel Condition



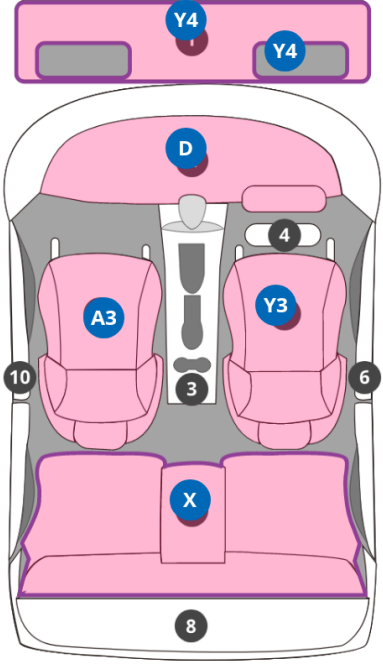
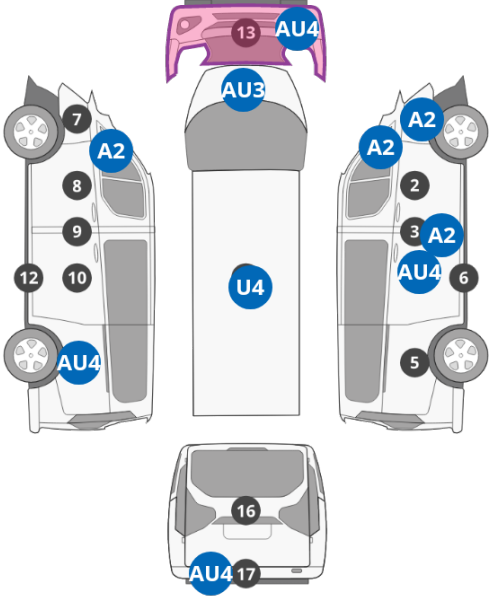
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.0	130	129	122
2	Boot Lid	126.3	137	119	123
3	Roof	101.9	96	85	121/106
4	Left Front Fender	133.6	120	151	130
5	Left Front Door	181.0	211	180	152
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	141.0	106	141	176
9	Right Front Fender	140.6	133	143	146
10	Right Front Door	272.0	237	373	206
11	Center Panel Right				
12	Right Rear Door	226.0	384	133	161
13	Right Back Panel	237.3	192	208	312

## Overall Evaluation :

D

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / (R) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Large / Room Lamp - Partially Missing - Yes / (L) Front Seat - Cut, Crack - Medium / Rear Seat - Partially Missing - Yes</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch &amp; Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (R) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Center Panel - Scratch - Small / Roof - Dent - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Trunk door issue cannot open. One seat missing. without warranty booklet,jack and tools. with spare tire. 2 keys. No LTO plate. aircon issue. steering issue. washer fluid warning light.</p>