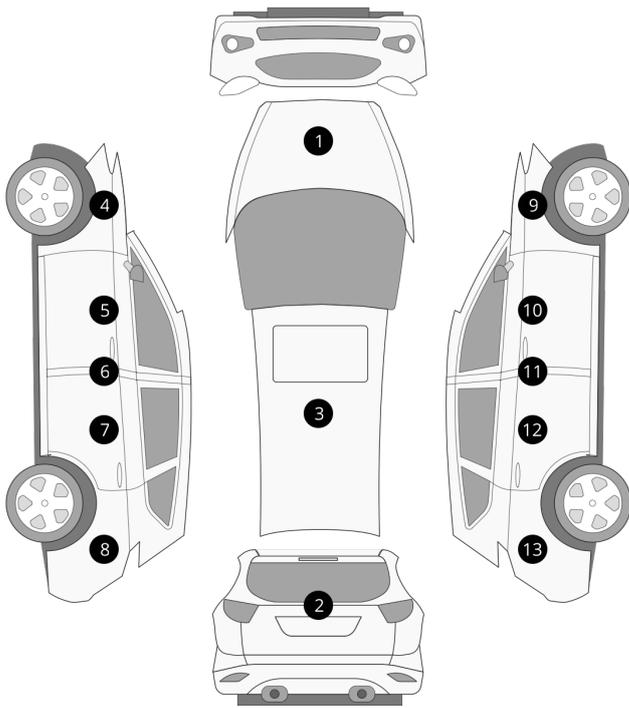


## General Information

Date & Time: 20, Jun, 2025 11:03

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	34,412
<b>Registration No.</b>	NFR1257	<b>Chassis No.</b>	PA1B18F32R4247150
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



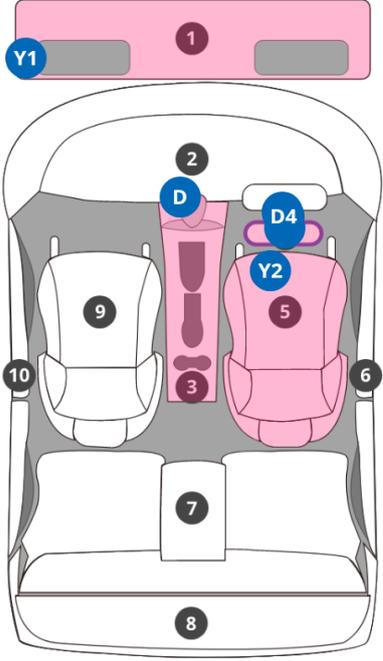
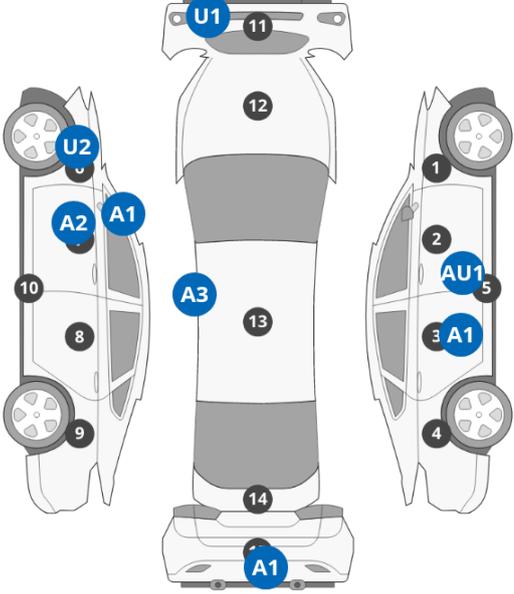
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.6	98	91	101
2	Boot Lid	99.7	99	98	103
3	Roof	91.4	93	87	97/89
4	Left Front Fender	85.6	87	88	82
5	Left Front Door	93.8	96	99	87
6	Center Panel Left				
7	Left Rear Door	92.5	101	93	84
8	Left Back Panel	92.8	103	91	84
9	Right Front Fender	90.7	89	93	91
10	Right Front Door	92.1	92	92	92
11	Center Panel Right				
12	Right Rear Door	93.1	91	88	101
13	Right Back Panel	97.9	94	107	93

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Mat Other - Missing - Yes / (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Large / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Dent - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Power Steering - Issue - Yes / Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail</p>