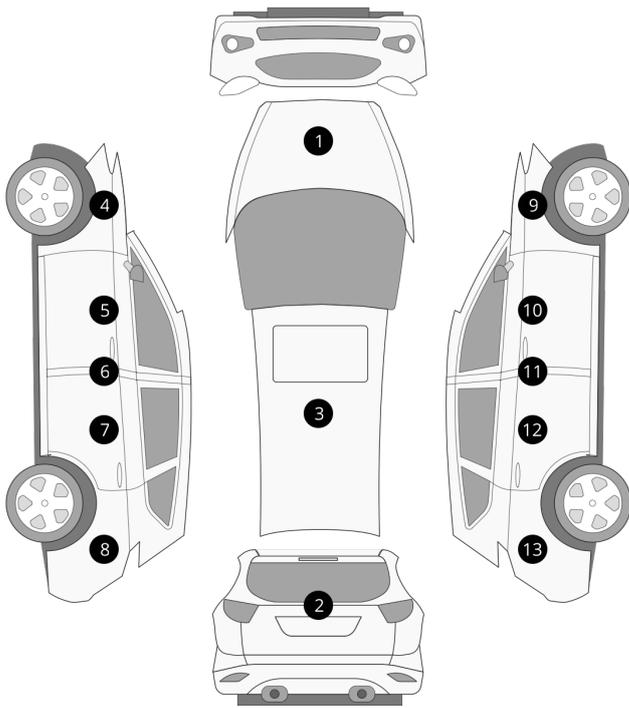


General Information

Date & Time: 20, Jun, 2025 08:48

Make	Suzuki	Model	Dzire
YOM	2024	Odo Meter Reading	24,688
Registration No.	NKA6738	Chassis No.	MBHZF63S6RG478122
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



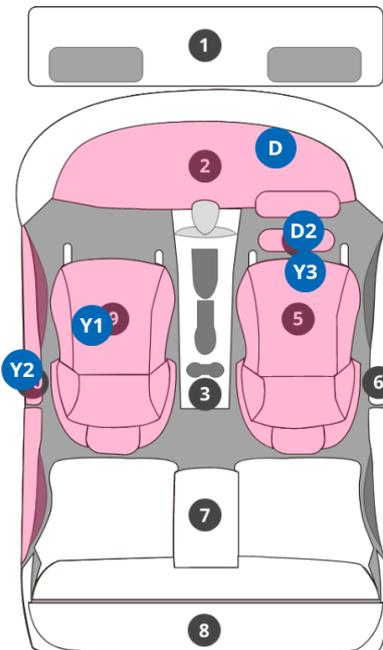
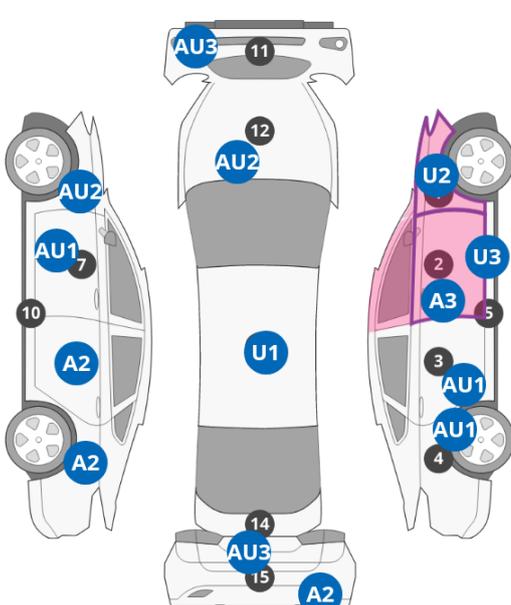
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	92.3	86	98	93
2	Boot Lid	74.5	77	74	73
3	Roof	89.2	84	84	91/98
4	Left Front Fender	83.5	86	86	79
5	Left Front Door	93.1	92	94	94
6	Center Panel Left				
7	Left Rear Door	79.6	83	78	78
8	Left Back Panel	81.5	82	83	81
9	Right Front Fender	278.3	250	191	394
10	Right Front Door	186.3	200	162	197
11	Center Panel Right				
12	Right Rear Door	78.5	78	74	84
13	Right Back Panel	87.6	85	90	88

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Front Fender, Molding - Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Medium / Roof - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate and Jack, Sparetire and incomplete tools. no warranty booklet, scratch headlight and crack and scratch tail lights.</p>