

General Information

Date & Time: 28, Oct, 2024 15:41

Make	Toyota	Model	Vios
YOM	2024	Mileage	6,336
Registration No.	DBO1293	Chassis No.	PA1B18F34P4236924
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



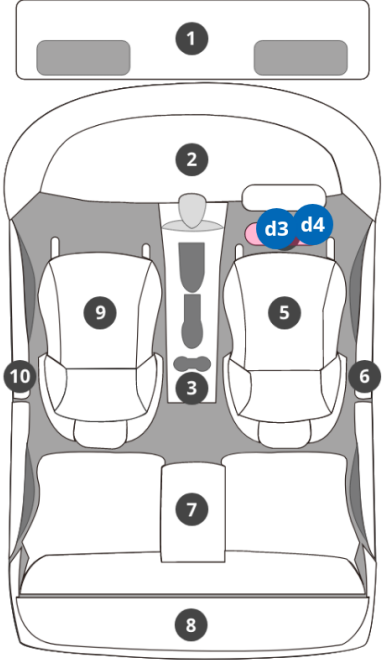
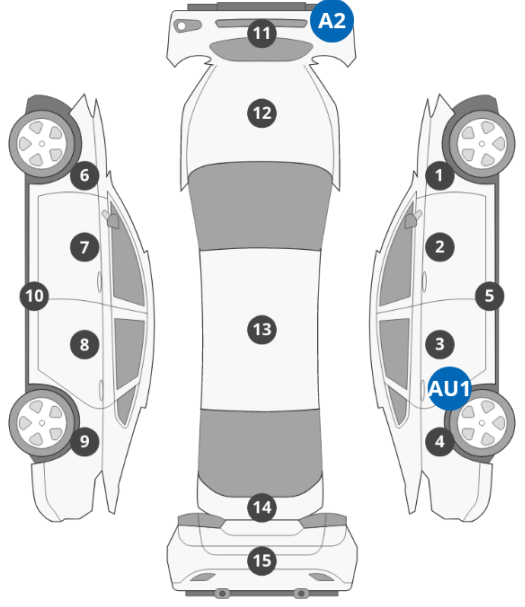
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.6	132	118	130
2	Boot Lid	125.3	111	129	136
3	Roof	117.7	117	112	114/128
4	Left Front Fender	112.3	120	115	102
5	Left Front Door	171.0	168	170	175
6	Center Panel Left				
7	Left Rear Door	189.3	195	188	185
8	Left Back Panel	186.0	199	178	181
9	Right Front Fender	119.3	116	119	123
10	Right Front Door	117.3	122	113	117
11	Center Panel Right				
12	Right Rear Door	131.6	124	136	135
13	Right Back Panel	128.0	125	122	137

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Lag - Loose, Deformed, Grime - Large / Lag Other - Loose, Deformed, Grime - Medium	Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : D	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Condition of Welding ? - Yes / Left Center Pillar - Condition of Welding ? - Yes / Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes
signs of repair on the driver door, rear left door, rear left fender/no reverse camera/ no retractable mirror/ swirl marks and hairline scratches