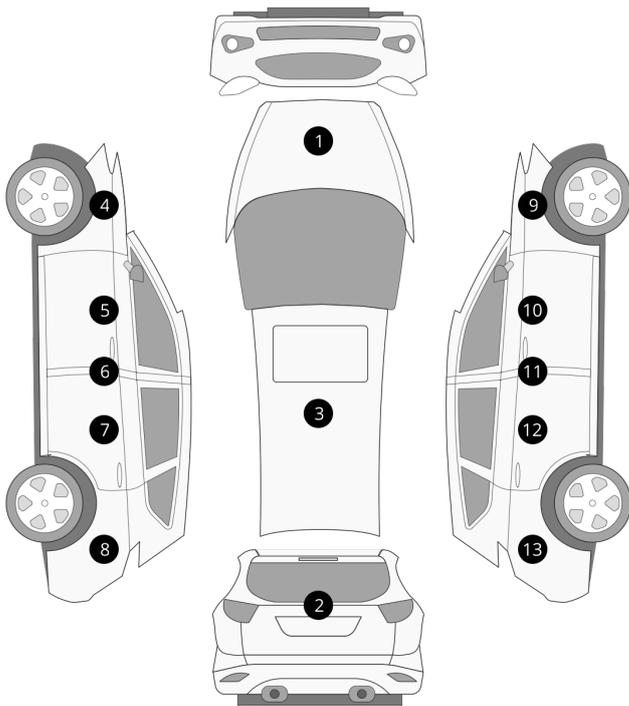


## General Information

Date & Time: 19, Jun, 2025 15:14

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	27,942
<b>Registration No.</b>	NFQ4359	<b>Chassis No.</b>	PA1B18F31L4129369
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



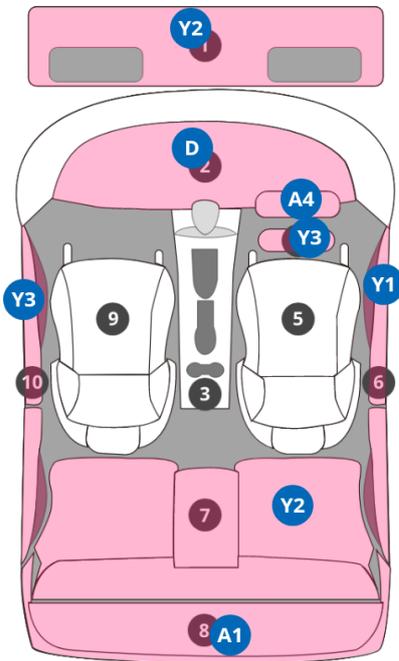
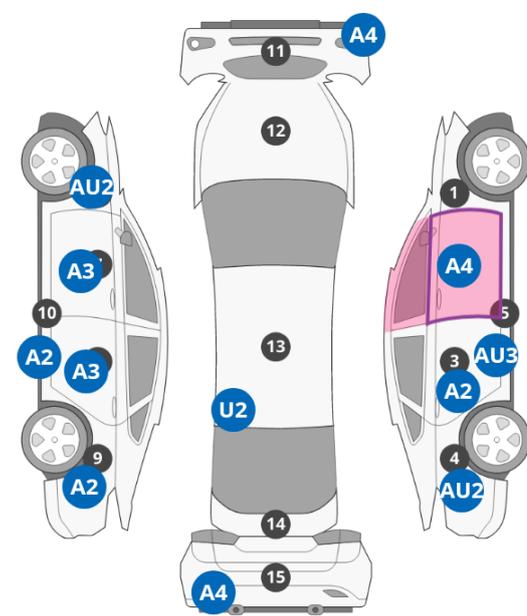
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	92.0	92	89	95
2	Boot Lid	93.2	93	90	97
3	Roof	83.5	91	70	79/95
4	Left Front Fender	124.6	124	137	113
5	Left Front Door	88.6	86	92	88
6	Center Panel Left				
7	Left Rear Door	129.0	133	136	118
8	Left Back Panel	93.9	97	92	93
9	Right Front Fender	146.3	154	154	131
10	Right Front Door	178.6	202	170	164
11	Center Panel Right				
12	Right Rear Door	81.2	76	80	88
13	Right Back Panel	87.3	81	90	91

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Dashboard - Traces of Adhesive Tape - Yes / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Large</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No warranty booklet/No jack and tools/right side tail light cover crack/No reverse camera</p>