

## General Information

Date & Time: 20, Jun, 2025 13:07

<b>Make</b>	Toyota	<b>Model</b>	Fortuner
<b>YOM</b>	2017	<b>Odo Meter Reading</b>	43,136
<b>Registration No.</b>	NDD3732	<b>Chassis No.</b>	MHFGB8GS3G0820277
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	SUV
<b>Colour</b>	Gray		

## Body / Panel Condition



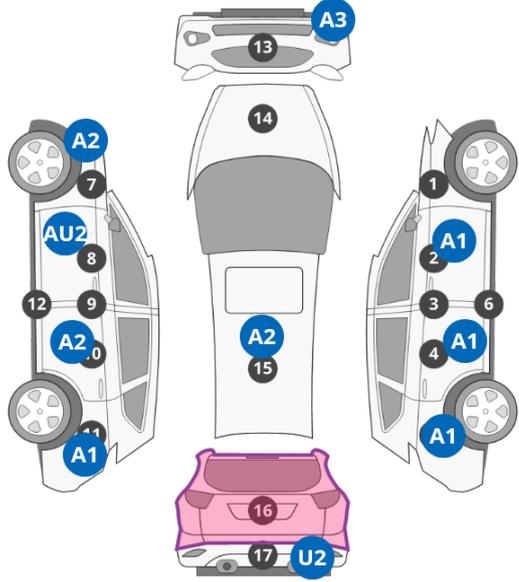
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	148.3	145	164	136
2	Boot Lid	478.0	193	1,040	201
3	Roof	112.0	114	127	94/113
4	Left Front Fender	121.3	122	118	124
5	Left Front Door	153.0	149	173	137
6	Center Panel Left				
7	Left Rear Door	116.0	123	108	117
8	Left Back Panel	117.0	127	107	117
9	Right Front Fender	113.6	123	103	115
10	Right Front Door	124.0	126	122	124
11	Center Panel Right				
12	Right Rear Door	118.6	130	106	120
13	Right Back Panel	139.6	149	121	149

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
<div style="text-align: center; background-color: #cccccc; padding: 50px;">  <p>No Image</p> </div> <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Small</p>	<p><b>Remarks</b> Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>No LTO plate/No spare tire/No jack and tools/No warranty booklet/No reverse camera</p>