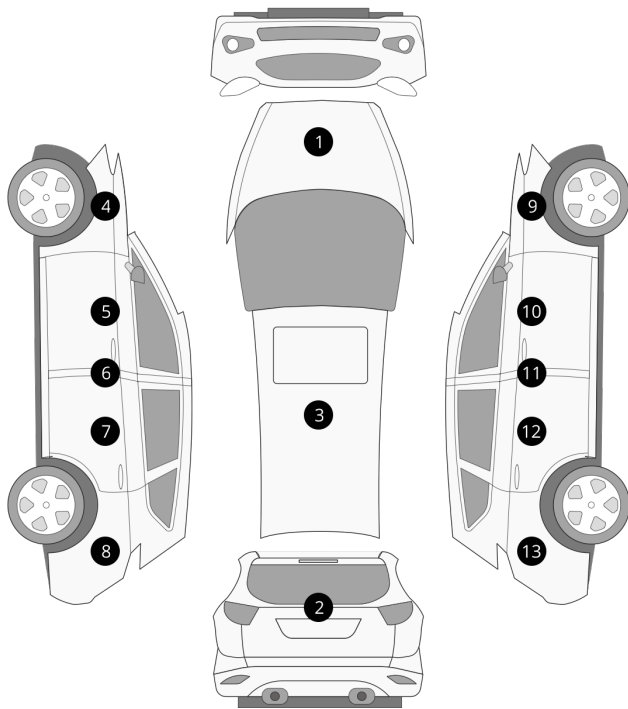


General Information

Date & Time: 14, Jun, 2025 10:12

Make	Toyota	Model	Vios
YOM	2016	Odo Meter Reading	392,250
Registration No.	ABQ3358	Chassis No.	NCP1512053304
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



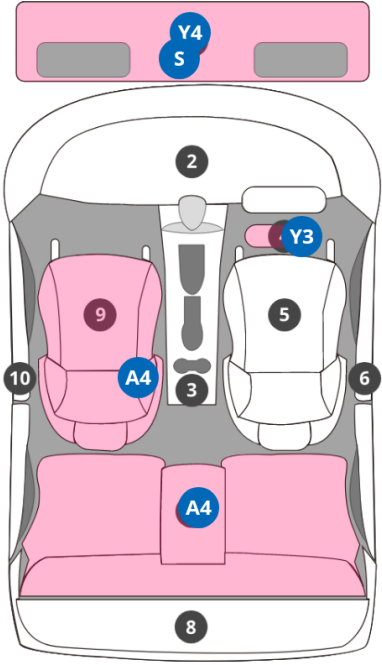
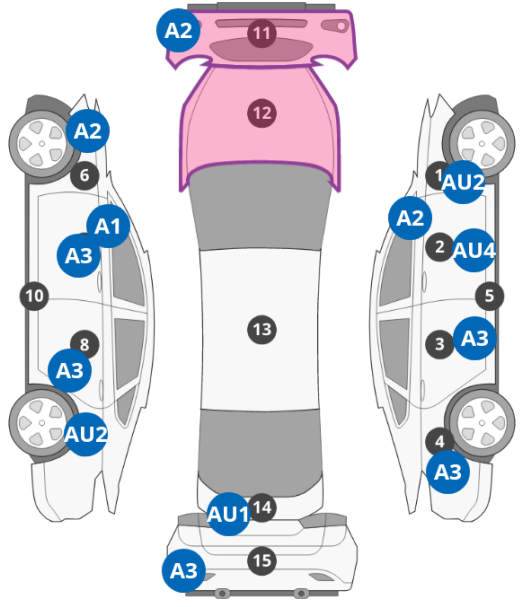
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	414.6	377	480	387
2	Boot Lid	139.0	141	131	145
3	Roof	176.2	146	178	198/183
4	Left Front Fender	278.6	352	277	207
5	Left Front Door	167.6	157	176	170
6	Center Panel Left				
7	Left Rear Door	174.6	200	161	163
8	Left Back Panel	205.0	313	147	155
9	Right Front Fender	228.0	233	222	229
10	Right Front Door	167.0	186	182	133
11	Center Panel Right				
12	Right Rear Door	338.3	269	366	380
13	Right Back Panel	280.3	243	278	320

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Floor Mat - Grime - Medium / Rear Seat - Cut, Crack - Large / (L) Front Seat - Cut, Crack - Large / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / (L) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
Possible flooding. bonnet/Hood issue. With warranty booklet, spare tire, jack and tools. Without seat cover. grime at center armrest. 1 key. With LTO plate.