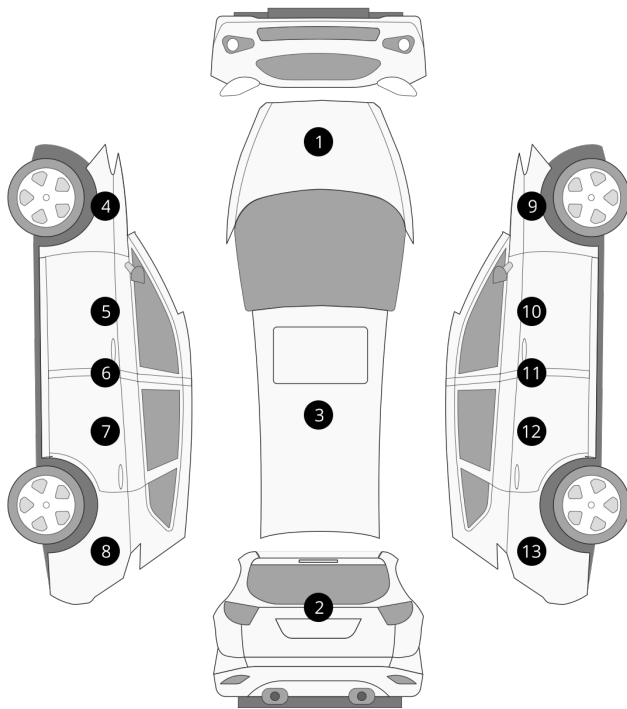


General Information

Date & Time: 16, Jun, 2025 14:40

Make	Toyota	Model	Innova
YOM	2020	Odo Meter Reading	218,183
Registration No.	DAZ5554	Chassis No.	PA2CA8EM7K0071269
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



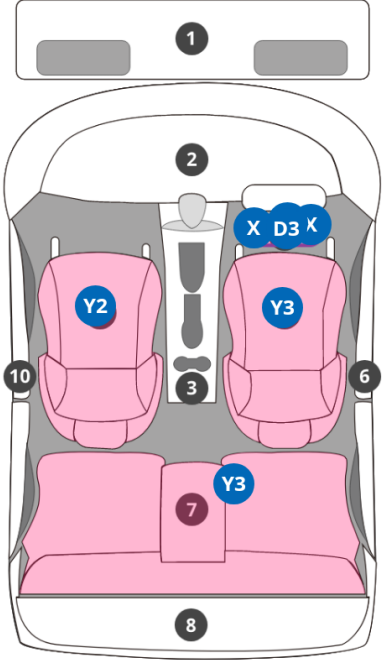
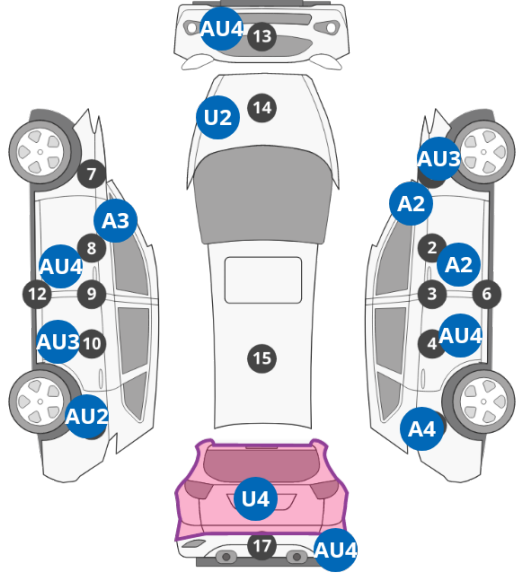
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.6	122	127	122
2	Boot Lid	366.3	301	358	440
3	Roof	92.1	100	98	86/86
4	Left Front Fender	99.6	101	104	94
5	Left Front Door	111.6	111	109	115
6	Center Panel Left				
7	Left Rear Door	102.5	107	102	99
8	Left Back Panel	117.6	120	111	122
9	Right Front Fender	101.0	101	100	102
10	Right Front Door	110.3	109	112	110
11	Center Panel Right				
12	Right Rear Door	147.0	134	196	111
13	Right Back Panel	118.0	106	110	138

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Carpet - Loose, Deformed - Medium / (L) Front Seat - Grime - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Mirror - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooding. without warranty booklet and seat cover. with spare tire, jack and tools. Abnormal engine sound. 1 key. with LTO plate. parklight missing.