

General Information

Date & Time: 16, Jun, 2025 13:01

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	9,555
Registration No.	NHS3158	Chassis No.	PA1B18F32R4261758
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



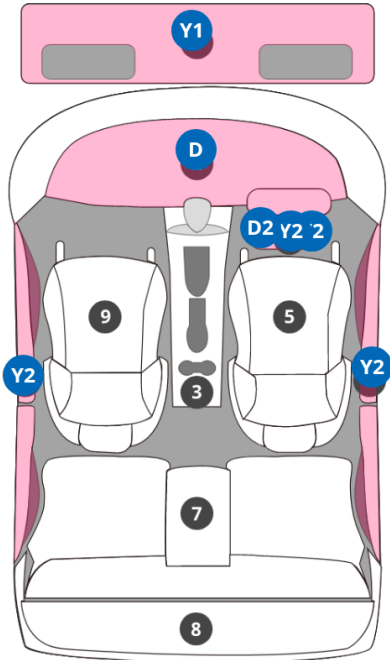
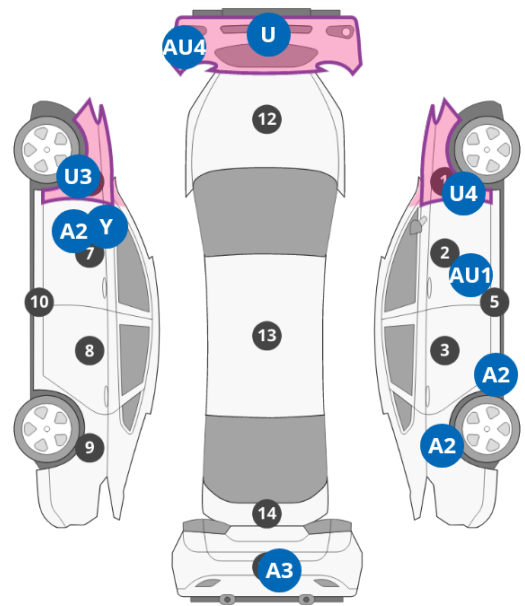
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	110	116	111
2	Boot Lid	108.6	104	114	108
3	Roof	99.2	100	90	97/111
4	Left Front Fender	232.0	229	231	236
5	Left Front Door	109.0	108	110	109
6	Center Panel Left				
7	Left Rear Door	100.8	106	99	97
8	Left Back Panel	105.3	120	94	102
9	Right Front Fender	163.6	154	147	190
10	Right Front Door	105.6	113	105	99
11	Center Panel Right				
12	Right Rear Door	106.0	111	101	106
13	Right Back Panel	106.0	100	101	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Mirror - Crack - Damaged / (L) Front Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Dent - Medium / (R) Front Fender, Molding - Dent - Large / Overall Exterior - Re-Paint Uneven - Yes
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
Underchassis cover loose. left sidemirror loose. Gap at front bumper. with warranty booklet, spare tire, tools and seat cover. without jack. 1 key. with LTO plate