

General Information

Date & Time: 27, Jun, 2025 13:07

Make	Toyota	Model	Hiace
YOM	2023	Odo Meter Reading	91,769
Registration No.	CBT3253	Chassis No.	JTFJT02PXN5033031
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



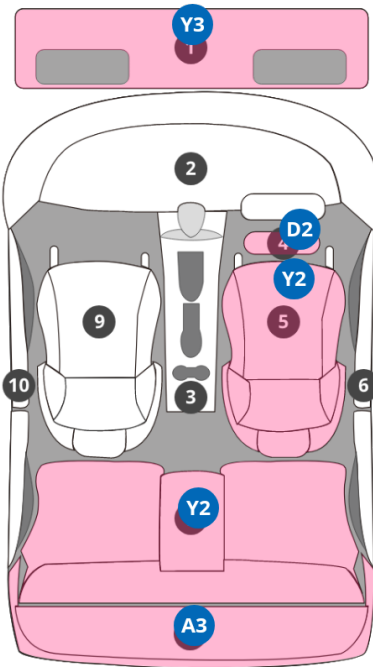
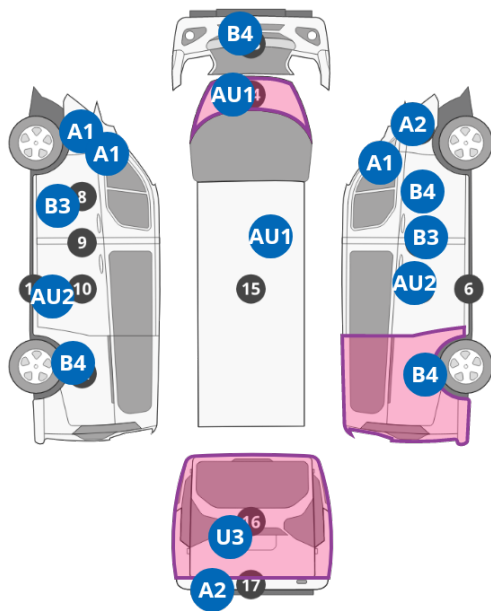
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	227.0	205	228	248
2	Boot Lid	184.0	185	183	184
3	Roof	127.5	131	134	132/113
4	Left Front Fender	152.6	203	128	127
5	Left Front Door	123.0	123	120	126
6	Center Panel Left	118.6	109	132	115
7	Left Rear Door	110.0	112	109	109
8	Left Back Panel	112.3	107	114	116
9	Right Front Fender	121.6	119	124	122
10	Right Front Door	117.3	118	122	112
11	Center Panel Right	124.6	128	119	127
12	Right Rear Door	111.3	108	111	115
13	Right Back Panel	206.0	212	218	188

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C		Exterior Evaluation : E	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Medium / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Overall Interior - Worn as per age - Yes		Remarks Front Panel - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Front Panel - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Front Door, Molding - Modified - Large / (R) Center Panel - Modified - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Modified - Large / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Modified - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Modified - Medium / Front Bumper, Grille, Lamps - Modified - Large / Front Panel - Scratch & Dent - Minimal / Roof - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Reverse Camera - N/A - Yes	

Inspector Notes

with LTO plate, no warranty booklet, no jack and tools, with spare tire, cracked tail light, traces of adhesive on front pillar and roof