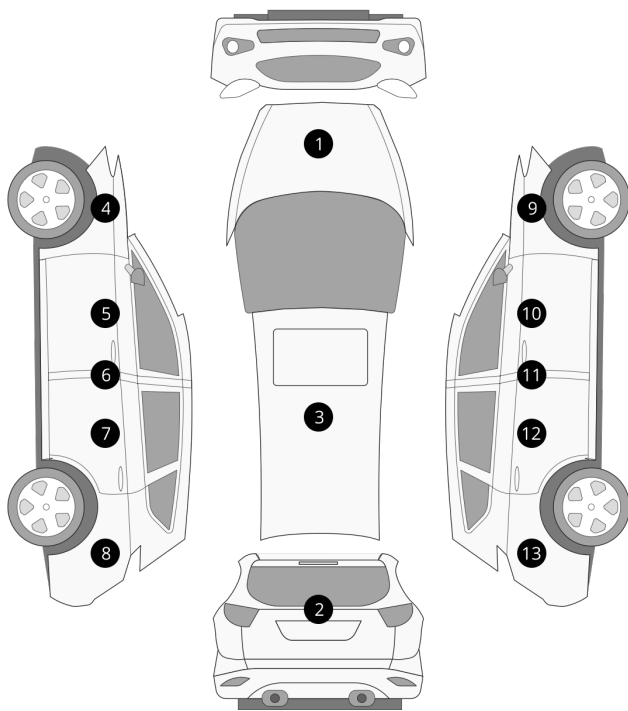


General Information

Date & Time: 01, Jul, 2025 13:03

Make	Suzuki	Model	Carry
YOM	2022	Odo Meter Reading	103,986
Registration No.	NHB5528	Chassis No.	MHYDC61T6PJ210218
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



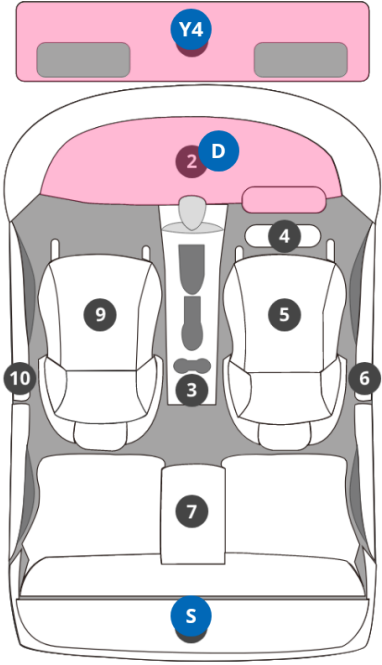
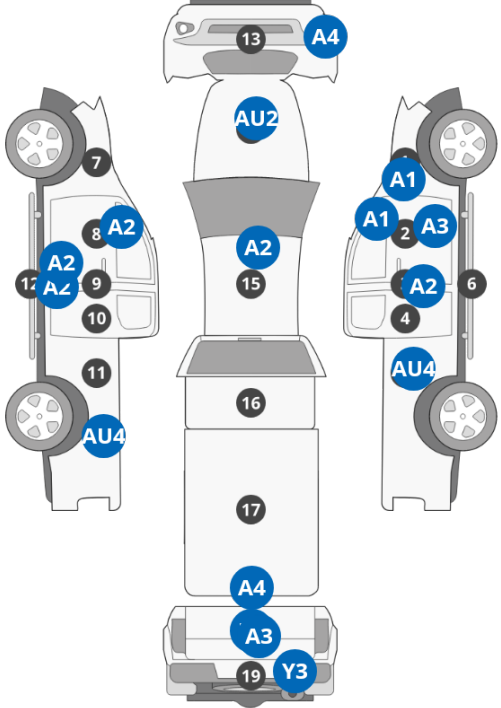
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.6	130	115	135
2	Boot Lid	169.6	169	177	163
3	Roof	109.8	124	105	112/98
4	Left Front Fender	149.0	156	147	144
5	Left Front Door	118.3	115	122	118
6	Center Panel Left	117.6	129	115	109
7	Left Rear Door				
8	Left Back Panel	204.0	183	258	171
9	Right Front Fender	125.0	123	129	123
10	Right Front Door	120.0	117	133	110
11	Center Panel Right	114.0	109	124	109
12	Right Rear Door				
13	Right Back Panel	154.3	128	167	168

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Large	Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Center Panel - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Rear Gate - Modified - Small / Rear Gate - Scratch - Medium / Cargo Bed Floor - Scratch - Large / (L) Side Gate - Scratch & Dent - Large / (L) Center Panel - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Small / Front Panel - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Door Lock - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Seat Belts - Issue - Yes

Inspector Notes

no warranty booklet, no jack and tools, with spare tire, with LTO plate, horn issue, plate light issue, door lock issue, adhesive mark on overall exterior, cracked tail light, seatbelt issue