


General Information

Date & Time: 27, Jun, 2025 10:45

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	57,071
Registration No.	NET4855	Chassis No.	PA1B18F3XM4147869
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition

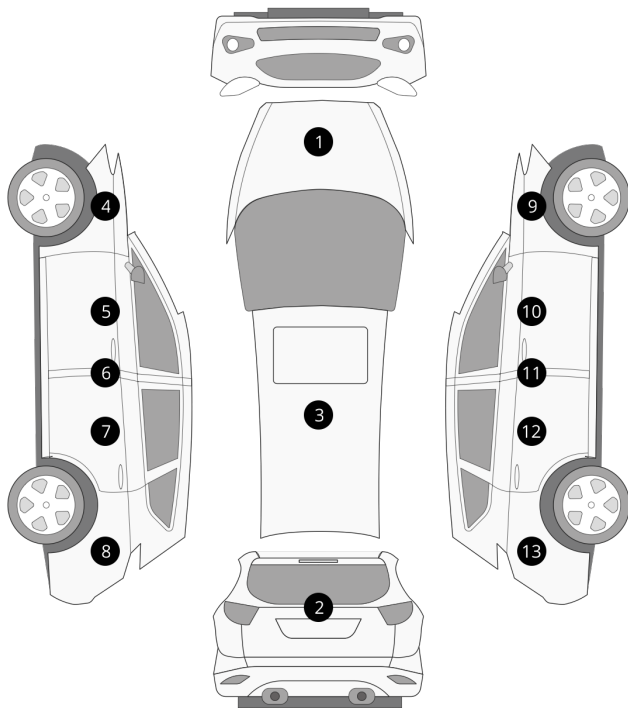

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	114	104	116
2	Boot Lid	114.6	115	111	118
3	Roof	103.1	112	95	107/99
4	Left Front Fender	115.6	121	113	113
5	Left Front Door	102.2	114	95	98
6	Center Panel Left				
7	Left Rear Door	107.3	106	116	100
8	Left Back Panel	204.3	207	198	208
9	Right Front Fender	94.0	99	91	93
10	Right Front Door	99.4	101	99	99
11	Center Panel Right				
12	Right Rear Door	97.7	96	96	102
13	Right Back Panel	102.3	105	101	101

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Medium / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small	Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Rust, Corrosion - Large / (L) Rear Fender, Molding - Rust, Corrosion - Medium / (L) Rear Door, Molding - Rust, Corrosion - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Rust, Corrosion - Large
Frame Evaluation : B	Functional Evaluation : A
Remarks Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, no jack and tools, with spare tire, busted reverse light and plate light