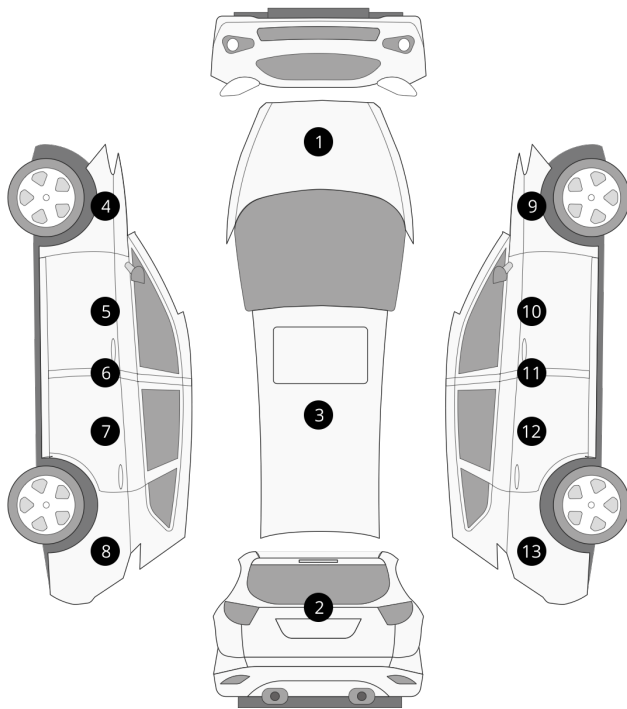


General Information

Date & Time: 27, Jun, 2025 09:50

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	55,827
Registration No.	NHJ3364	Chassis No.	PA1B18F36P4211233
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



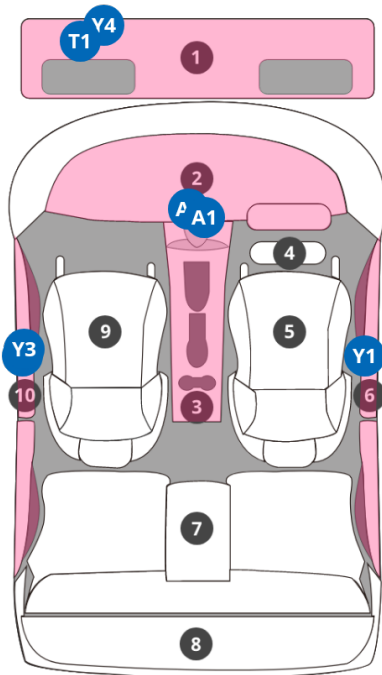
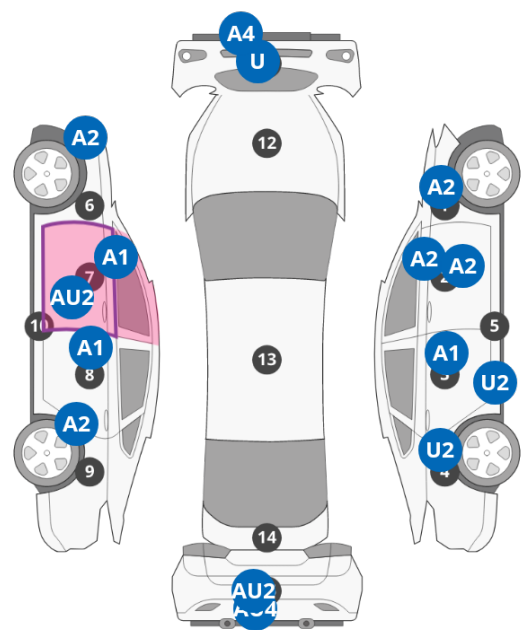
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.6	123	132	119
2	Boot Lid	114.0	111	111	120
3	Roof	107.5	113	102	109/106
4	Left Front Fender	145.6	168	101	168
5	Left Front Door	149.3	151	135	162
6	Center Panel Left				
7	Left Rear Door	180.6	179	186	177
8	Left Back Panel	104.5	107	94	113
9	Right Front Fender	104.6	100	114	100
10	Right Front Door	95.3	99	93	94
11	Center Panel Right				
12	Right Rear Door	103.5	93	102	116
13	Right Back Panel	101.8	100	100	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Worked - Small / (L) Front Trim - Grime - Medium / Ceiling - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Cigarette Burns - Burnt Minimal	Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, damaged LTO plate, cracked tail light