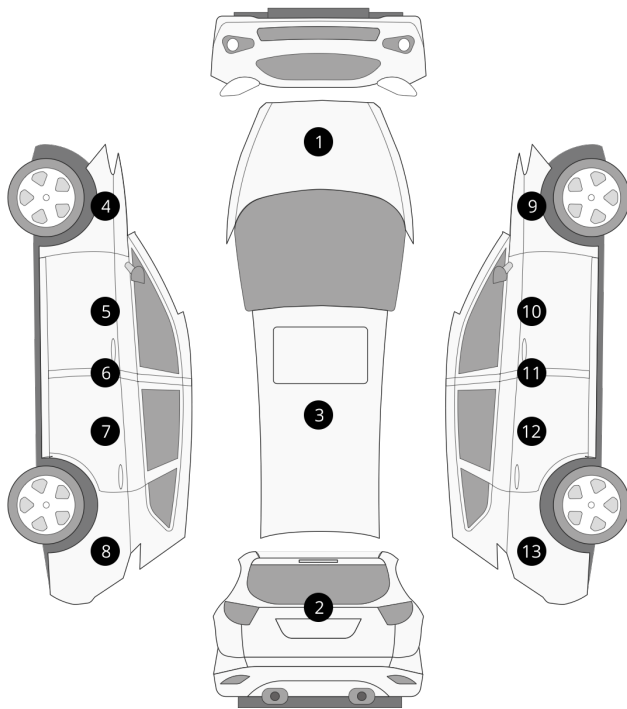


General Information

Date & Time: 25, Jun, 2025 10:04

Make	Suzuki	Model	Carry
YOM	2022	Odo Meter Reading	16,625
Registration No.	NGQ9360	Chassis No.	MHYDC61T6PJ211028
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



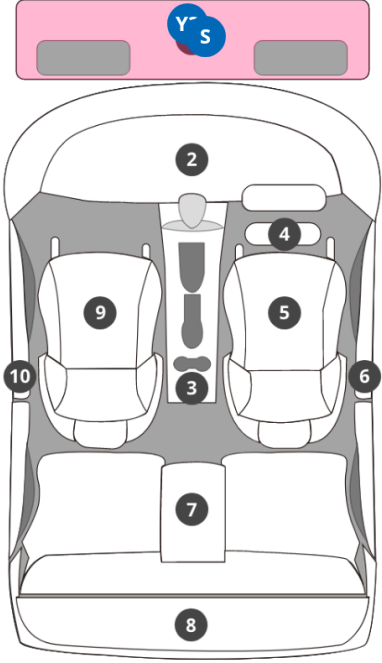
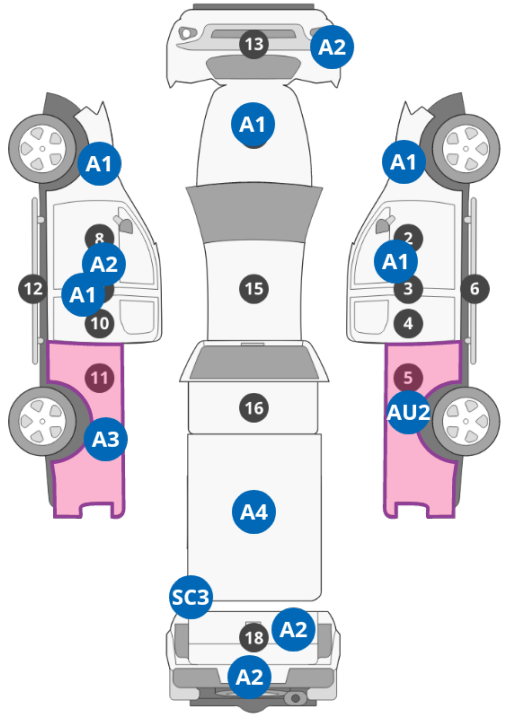
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	116	117	119
2	Boot Lid	146.0	161	120	157
3	Roof	97.5	106	98	90/96
4	Left Front Fender	116.0	127	103	118
5	Left Front Door	102.6	100	106	102
6	Center Panel Left	102.6	106	106	96
7	Left Rear Door	103.1	99	99	111
8	Left Back Panel	183.0	189	185	175
9	Right Front Fender	119.6	117	119	123
10	Right Front Door	109.6	106	114	109
11	Center Panel Right	118.0	117	117	120
12	Right Rear Door	116.3	115	118	116
13	Right Back Panel	196.6	218	166	206

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Overall Interior - Smell - Yes	Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Small / (R) Side Gate - Repair mark - Yes / Roof - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Small / (L) Side Gate - Repair mark - Yes / (L) Side Gate - Scratch - Medium / (L) Center Panel - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Front Panel - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Cargo Bed Floor - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate, no warranty booklet, no jack and tools, with spare tire, no center panel glass,