

General Information

Date & Time: 02, Jul, 2025 10:11

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	10,794
Registration No.	NHS6784	Chassis No.	MHKU3FE10RK008236
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



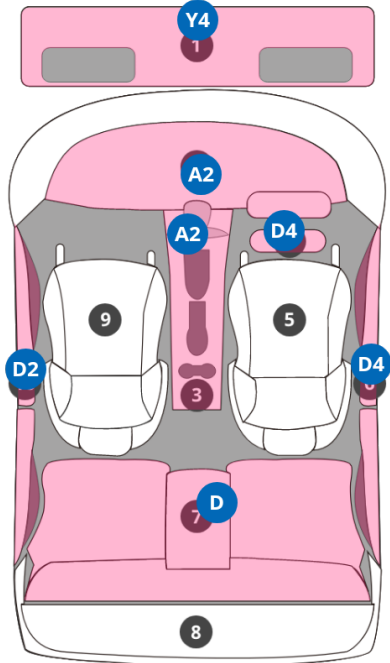
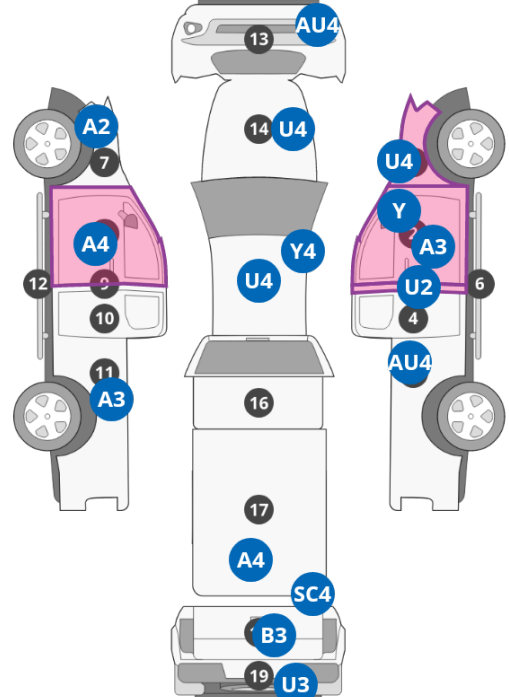
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	83.0	91	84	74
2	Boot Lid	118.0	118	117	119
3	Roof	70.9	60	77	73/74
4	Left Front Fender	71.2	64	69	81
5	Left Front Door	71.9	86	63	66
6	Center Panel Left	77.0	83	79	69
7	Left Rear Door	120.0	110	107	143
8	Left Back Panel	163.4	254	139	97
9	Right Front Fender	226.3	282	199	198
10	Right Front Door	85.1	105	67	83
11	Center Panel Right	104.6	108	128	78
12	Right Rear Door	126.0	124	130	124
13	Right Back Panel	121.0	106	111	146

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Worked - Large / Ceiling - Grime - Large / Rear Seat - Worn - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Large	Remarks (R) Front Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / (R) Mirror - Crack - Damaged / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Dent - Large / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Center Panel - Repair mark - Yes / (R) Center Panel - Dent - Small / Overall Exterior - Re-Paint Uneven - Yes / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Dent - Medium / Rear Gate - Modified - Medium / (L) Side Gate - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Door, Molding - Repair mark - Yes / Roof - Dent - Large / Cargo Bed Floor - Scratch - Large / Cab Back Panel - Rust, Corrosion - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Panel - Dent - Large / (L) Front Fender, Molding - Scratch - Small / Front Windshield - Damaged - Large
Frame Evaluation : D	Functional Evaluation : B
Remarks Right Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak

Inspector Notes
with LTO plate, no warranty booklet, with jack, no tools, with rim and tire, damaged front windshield, side mirror issue, front panel issue, loosed ceiling, headlight and tail light scratch, corrosion on engine, right cab glass missing , mould on rear seat, wiper missing, busted brake light