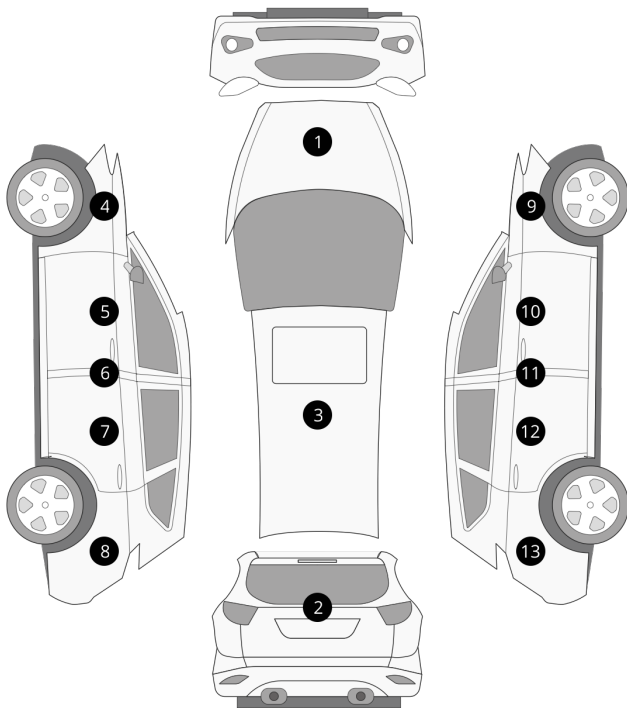


General Information

Date & Time: 01, Jul, 2025 08:37

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	94,655
Registration No.	EAE4895	Chassis No.	PA1B18F39M4157034
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



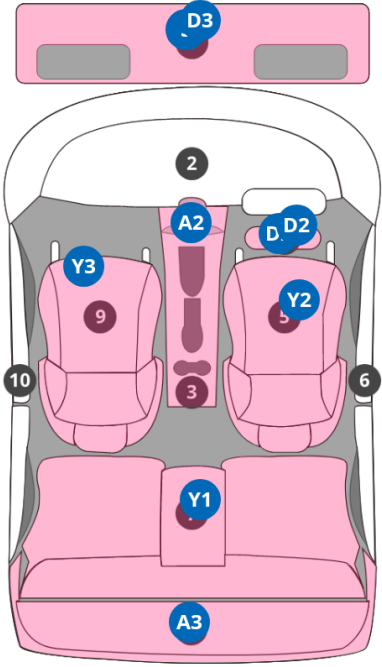
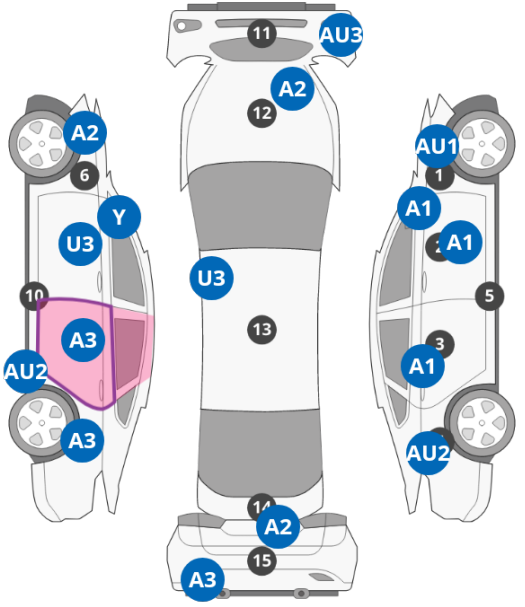
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	123	108	123
2	Boot Lid	132.0	130	127	139
3	Roof	104.0	103	103	105/105
4	Left Front Fender	101.6	104	99	102
5	Left Front Door	112.3	114	112	111
6	Center Panel Left				
7	Left Rear Door	173.0	170	169	180
8	Left Back Panel	117.6	125	112	116
9	Right Front Fender	104.6	108	100	106
10	Right Front Door	107.3	104	110	108
11	Center Panel Right				
12	Right Rear Door	110.0	103	107	120
13	Right Back Panel	110.3	107	108	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Medium / Overall Interior - Smell - Yes / Ceiling - Crinkle - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Medium / Overall Interior - Worn as per age - Yes / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small	Remarks (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Dent - Medium / Roof - Dent - Medium / (L) Mirror - Crack - Damaged / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, no jack and tools, no spare tire, damaged left side mirror, damaged left fender lining, possible flooded