

General Information

Date & Time: 27, Jun, 2025 13:50

Make	Toyota	Model	Innova
YOM	2023	Odo Meter Reading	71,791
Registration No.	NHA2703	Chassis No.	PA2JA8EM8P0127245
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



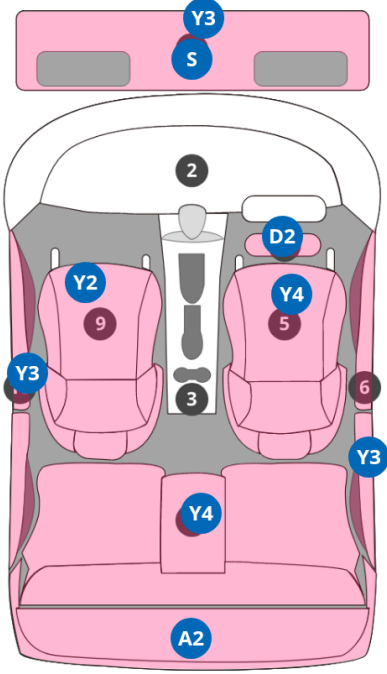
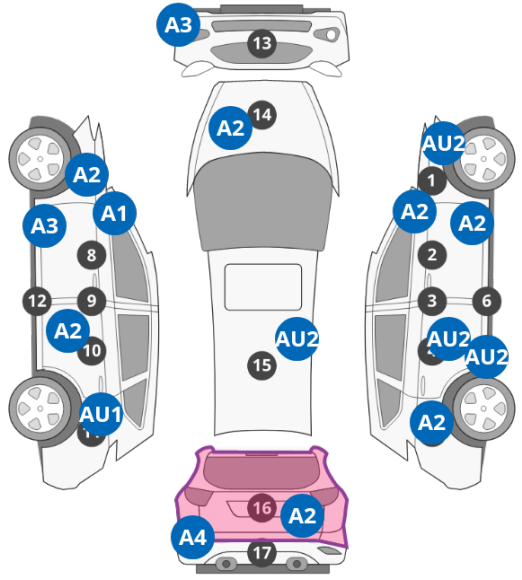
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	103	130	104
2	Boot Lid	180.0	176	182	182
3	Roof	113.0	102	113	123/114
4	Left Front Fender	103.1	100	105	105
5	Left Front Door	108.3	111	107	107
6	Center Panel Left				
7	Left Rear Door	139.0	146	147	124
8	Left Back Panel	114.3	115	114	114
9	Right Front Fender	112.3	110	118	109
10	Right Front Door	109.0	112	107	108
11	Center Panel Right				
12	Right Rear Door	109.8	100	107	123
13	Right Back Panel	111.6	107	110	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / Ceiling - Grime - Medium / (R) Rear Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Worked - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, with jack and tools, with spare tire, cracked tail light, tail light issue, possible flooded