

General Information

Date & Time: 27, Jun, 2025 16:42

Make	Suzuki	Model	APV
YOM	2020	Odo Meter Reading	36,324
Registration No.	NGF4667	Chassis No.	MHYDN71V0LJ402617
CC	1.6	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	Gray		

Body / Panel Condition



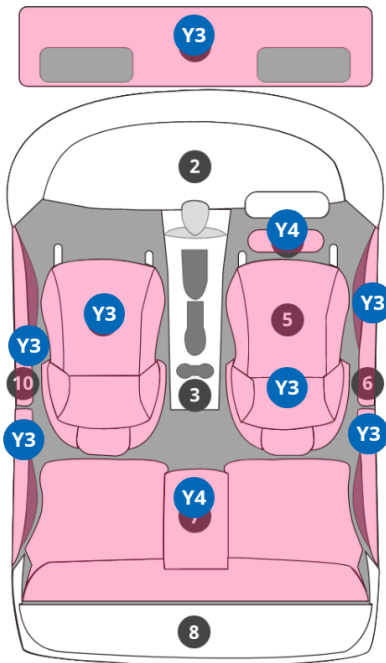
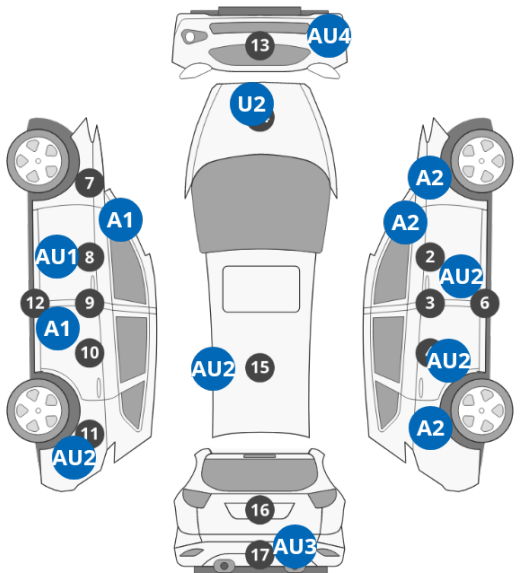
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.1	106	96	90
2	Boot Lid	184.0	185	189	178
3	Roof	93.9	83	86	109/98
4	Left Front Fender	126.3	116	120	143
5	Left Front Door	212.0	130	131	375
6	Center Panel Left				
7	Left Rear Door	220.6	389	139	134
8	Left Back Panel	177.3	249	143	140
9	Right Front Fender	109.0	109	112	106
10	Right Front Door	104.6	112	100	102
11	Center Panel Right				
12	Right Rear Door	128.3	128	127	130
13	Right Back Panel	125.0	133	120	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Large / (R) Rear Trim - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Watermarks on taillight. Drive belt abnormal noise issue. Without warranty booklet,jack and tools. With spare tire. 1 key. With LTO plate, Trunk stay issue. interior light issue.