

General Information

Date & Time: 05, Nov, 2024 16:01

Make	Toyota	Model	Vios
YOM	2023	Mileage	18,608
Registration No.	NHR4477	Chassis No.	PA1B18F3XP4225796
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



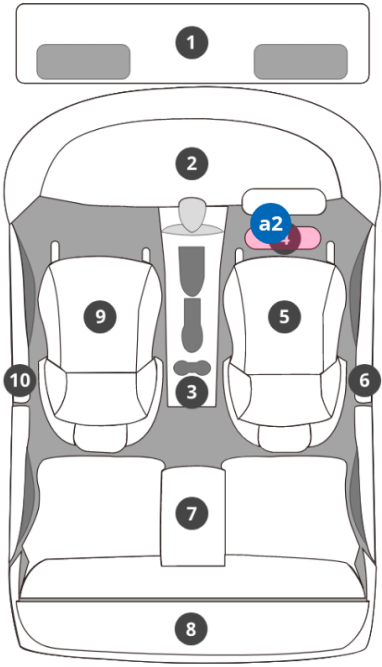
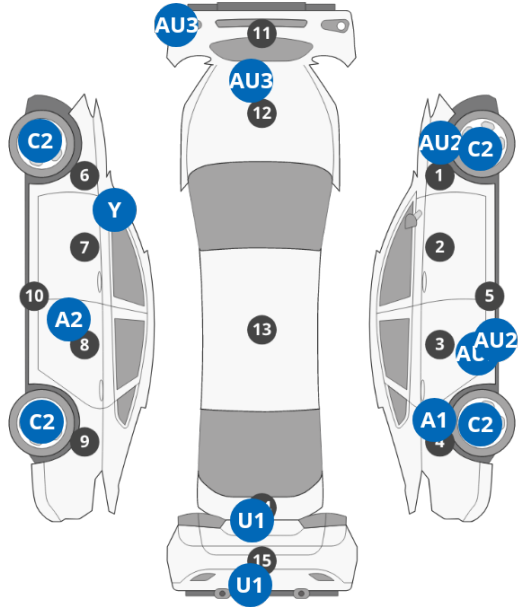
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	122	119	118
2	Boot Lid	117.0	115	115	121
3	Roof	121.2	119	111	123/132
4	Left Front Fender	112.0	116	108	112
5	Left Front Door	110.3	107	101	123
6	Center Panel Left				
7	Left Rear Door	129.3	144	128	116
8	Left Back Panel	123.0	115	119	135
9	Right Front Fender	114.3	115	112	116
10	Right Front Door	113.6	118	110	113
11	Center Panel Right				
12	Right Rear Door	122.0	118	122	126
13	Right Back Panel	125.0	115	119	141

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Lag - Cut, Crack - Small	Remarks Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Mirror - Crack - Damaged / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Minimal / Rear Bumper, Lamps, Panels - Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no reverse camera/front right door adhesive scratch